

| | | | |
|------------|-------------|----------|---|
| Report ID: | 28,054,453 | Version: | 2 |
| Created: | 17 Mar 2026 | | |


| | | | |
|---------------|-------------|------------------|-------------------|
| Make: | Holden | Model: | Colorado |
| Body Style: | Utility | Year: | 2012 |
| Rego No.: | GLJ182 | Rego Expiry: | 25 Jan 2026 |
| WoF Expiry: | 17 Apr 2026 | Odometer: | 327,666 Kms |
| Good No.: | 28054453 | VIN: | MMU148EH0DH613477 |
| Next Service: | Unknown | Service History: | No |

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

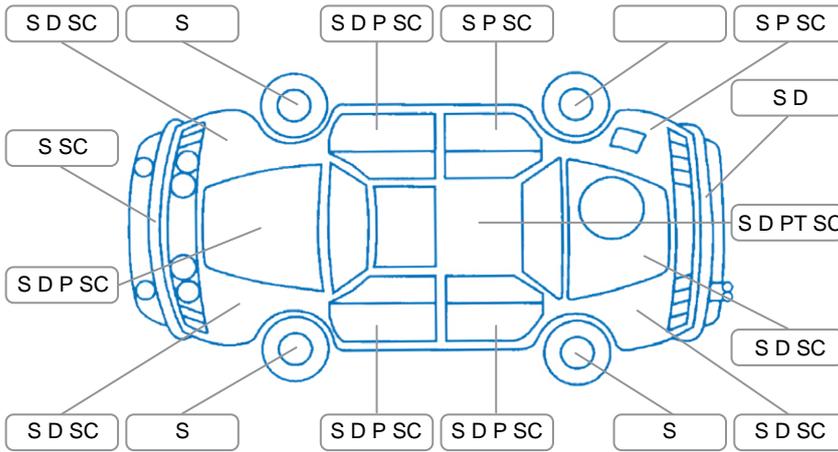

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Paint defect on RH side mirror and RH cant rail. Both cant rails dented.
 Rear bumper step plate moulding cracked. Rear bumper pushed in.
 Canopy window tints in poor condition. Stonechips in windscreen.
 LH taillight cracked, RH taillight chipped.

Conditions During Body Inspection Dry

Under Carriage and Under Bonnet Inspection Comments

Engine cover missing.

Interior Comments

Seats: Average, burn holes in RL seat base.
 Carpets: Average, missing floor mats, drivers footrest broken
 Panels: Poor, centre dash compartment lid not opening.
 Dashboard: Average, steering wheel worn.

General Comments

Radio head unit has been crudely installed, original facia cut.
 HVAC fan only operates on highest setting.
 Canopy high stop light not working.
 Rear suspension knock.

Road Conditions During Test Drive Dry

Engine Timing Mechanism Cambelt

Evidence of Cam Belt Replacement Yes No Kms

Inspected by: Troy Smith

Published by: Troy Smith

Inspection Date: 17 Mar 2026

| | OK | Requires Attention | N/A |
|---|----|--------------------|--------|
| Engine | | | |
| Oil level | ✓ | | |
| Smoke & fumes | ✓ | | |
| Engine performance | ✓ | | |
| Noise | ✓ | | |
| Coolant condition | ✓ | | |
| Cooling performance | ✓ | | |
| Radiator / Hoses (visual) | ✓ | | |
| Transmission | | | |
| Operation | ✓ | | |
| Noise | ✓ | | |
| Clutch | | | ✓ |
| CV joints | ✓ | | |
| Wheel bearings | ✓ | | |
| Brakes | | | |
| Performance | ✓ | | |
| Hand brake | ✓ | | |
| Tyres (lowest observed tread depth of tyres) | | | |
| Left front | | | 6 mm |
| Right front | | | 4 mm |
| Left rear | | | 6.5 mm |
| Right rear | | | 6.5 mm |
| Spare | | Yes | |
| Suspension | | | |
| Suspension performance | ✓ | | |
| Steering performance | ✓ | | |
| Shock absorbers | ✓ | | |
| Air Conditioning / Heater | | | |
| Operation | ✓ | | |
| Electrical / Accessories | | | |
| Head lights | ✓ | | |
| Tail lights | | ✓ | |
| Indicators | ✓ | | |
| Dashboard warning lights | ✓ | | |
| Wipers (front & rear) | ✓ | | |
| Window winder FL | ✓ | | |
| Window winder FR | ✓ | | |
| Window winder RL | ✓ | | |
| Window winder RR | ✓ | | |
| Rear view mirrors | ✓ | | |
| Radio (basic test only) | ✓ | | |
| CD (basic test only) | | | ✓ |
| Number of keys | 2 | | |
| Central locking | ✓ | | |
| Remote locking | ✓ | | |
| Sat. nav. (basic test only) | | | ✓ |
| Reversing camera | | | ✓ |

I have read and understood this condition guide:

NAME _____

SIGNATURE _____