


Report ID:	28,054,741	Version:	1
Created:	18 Mar 2026		

Make:	Honda	Model:	Insight
Body Style:	Hatchback	Year:	2010
Rego No.:	MFW284	Rego Expiry:	09 Jun 2026
WoF Expiry:	31 Oct 2026	Odometer:	224,265 Kms
Good No.:	28054741	VIN:	7AT08G9MX19205435
Next Service:	can't read	Service History:	No

**Note: This report is not a warranty**  
 This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key**  
 S = Scratch    R = Rust    C = Crack    \* = Decals    W = Significant scuffs  
 D = Dent    PT = Paint defect    P = Pin dent    SC = Stone Chips

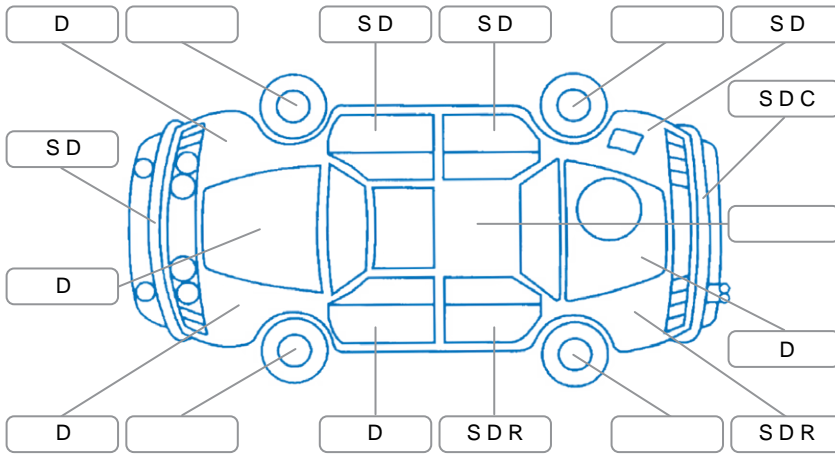

Note: some defects and blemishes may not be displayed in the diagram

### Body Inspection Comments

Driver body seal torn, L rear window not working, steering wheel torn, carpet torn, L wing mirror adjuster not folding, r rear body seal torn, passenger seat torn, parcel tray missing, number plate not working.

Conditions During Body Inspection: Dry

### Under Carriage and Under Bonnet Inspection Comments

Passenger seat belt twisted, both rear tyre cracked, front brake pad low, flat battery, engine oil leak

### Interior Comments

Seats:	Poor
Carpets:	Poor
Panels:	Poor
Dashboard:	Average

### General Comments

Front bumper not secured,

Road Conditions During Test Drive	Dry		
Engine Timing Mechanism	Timing Chain		
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes	<input type="checkbox"/> No	Kms
Inspected by:	Marlon Espena		
Published by:	Marlon Espena		
Inspection Date:	18 Mar 2026		

	OK	Requires Attention	N/A
<b>Engine</b>			
Oil level		✓	
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance		✓	
Hand brake	✓		
<b>Tyres (lowest observed tread depth of tyres)</b>			
Left front			3 mm
Right front			4 mm
Left rear			5 mm
Right rear			4 mm
Spare		No	
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL		✓	
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)		✓	
Number of keys	1		
Central locking	✓		
Remote locking		✓	
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood this condition guide:

NAME \_\_\_\_\_

SIGNATURE \_\_\_\_\_