

Report ID:	28,055,068	Version:	3
Created:	25 Mar 2026		


Make:	Ssangyong	Model:	Rexton
Body Style:	SUV	Year:	2014
Rego No.:	HJL996	Rego Expiry:	04 May 2026
WoF Expiry:	13 Oct 2026	Odometer:	185,022 Kms
Good No.:	28055068	VIN:	KPTH0C1FSEP333196
Next Service:	197021 kms	Service History:	No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

### Key

S = Scratch    R = Rust    C = Crack    \* = Decals    W = Significant scuffs  
 D = Dent    PT = Paint defect    P = Pin dent    SC = Stone Chips

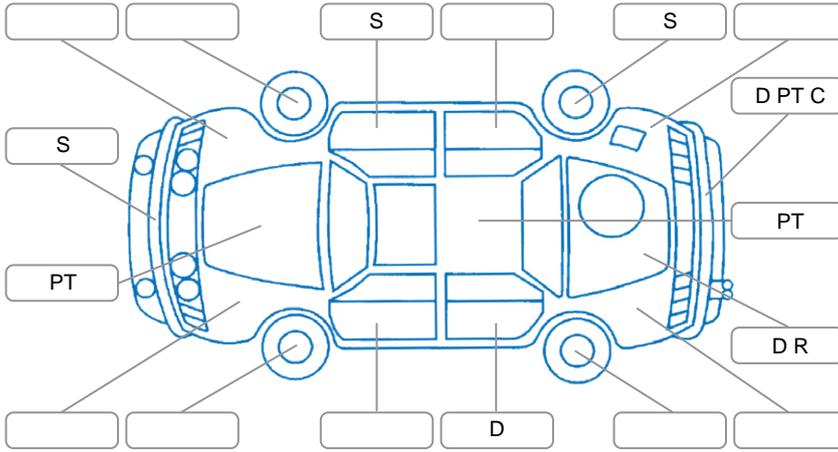

Note: some defects and blemishes may not be displayed in the diagram

### Body Inspection Comments

Left side mirror broken.  
 2nd row centre seatbelt not retracting correctly.  
 Driver and 2nd row left seatbelts fraying.

Conditions During Body Inspection: Dry

### Under Carriage and Under Bonnet Inspection Comments

Power steering pump leak. Front and rear brake pads and rotors worn. Rear axle bump stops perished. Engine oil and transfer case leaks. RF CV axle outer boot split.

### Interior Comments

Seats:	Poor
Carpets:	Average
Panels:	Average
Dashboard:	Average

### General Comments

Rear W/S defroster connection broken. A/C control screen not working. Left sun visor mirror cover missing. Rear W/S washer not working. Reversing image blurry. Brake pedal pulsating and steering shake while braking. W/S stone chip out of CVA.

Road Conditions During Test Drive	Dry		
Engine Timing Mechanism	Timing Chain		
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes	<input type="checkbox"/> No	Kms
Inspected by:	Eleoit Kumar		
Published by:	Sam Huang		
Inspection Date:	17 Mar 2026		

	OK	Requires Attention	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints		✓	
Wheel bearings	✓		
<b>Brakes</b>			
Performance		✓	
Hand brake	✓		
<b>Tyres (lowest observed tread depth of tyres)</b>			
Left front			6.0 mm
Right front			6.0 mm
Left rear			7.0 mm
Right rear			7.0 mm
Spare		Yes	
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation		✓	
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)		✓	
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera		✓	

I have read and understood this condition guide:

NAME \_\_\_\_\_

SIGNATURE \_\_\_\_\_