

Report ID:	28,058,479	Version:	2
Created:	21 Mar 2026		


Make:	Subaru	Model:	Impreza
Body Style:	Hatchback	Year:	2012
Rego No.:	RQZ717	Rego Expiry:	25 Mar 2026
WoF Expiry:	23 Oct 2026	Odometer:	185,117 Kms
Good No.:	28058479	VIN:	7AT0GF09X24007472
Next Service:	104,354 Kms	Service History:	No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

### Key

S = Scratch    R = Rust    C = Crack    \* = Decals    W = Significant scuffs  
 D = Dent    PT = Paint defect    P = Pin dent    SC = Stone Chips

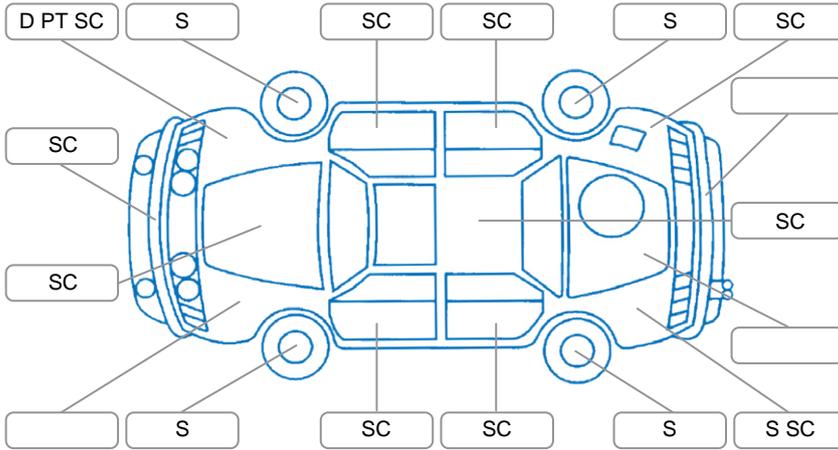

Note: some defects and blemishes may not be displayed in the diagram

### Body Inspection Comments

- RF fog light cracked.
- Stone chip in windscreen.
- Rear tow hook cover missing.
- Paint defect on rear spoiler.

Conditions During Body Inspection	Dry
-----------------------------------	-----

### Under Carriage and Under Bonnet Inspection Comments

- Car too low to put on hoist.
- Engine oil leak.

### Interior Comments

Seats:	Average, RF seat leather cracked
Carpets:	Good
Panels:	Average, Centre console loose
Dashboard:	Average, Holes drilled in dash

### General Comments

- Has adjustable suspension installed (Not certified).
- LR window fail.                      Radio not picking up stations.
- Spare tyre missing.                LF park light fail.
- Wheel brace missing.

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Cambelt
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input checked="" type="checkbox"/> No                      Kms
Inspected by:	Caleb Spicer Lee
Published by:	Tylar Stewart
Inspection Date:	18 Mar 2026

	OK	Requires Attention	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand brake	✓		
<b>Tyres (lowest observed tread depth of tyres)</b>			
Left front			6.0 mm
Right front			6.0 mm
Left rear			6.0 mm
Right rear			2.5 mm
Spare		No	
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL		✓	
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)		✓	
CD (basic test only)			✓
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood this condition guide:

NAME \_\_\_\_\_

SIGNATURE \_\_\_\_\_