

Report ID:	28,058,759	Version:	1
Created:	18 Mar 2026		


Make:	Nissan	Model:	March
Body Style:	Hatchback	Year:	2006
Rego No.:	JBK943	Rego Expiry:	07 Jun 2026
WoF Expiry:	01 Apr 2026	Odometer:	151,232 Kms
Good No.:	28058759	VIN:	7AT0DH0KX15868055
Next Service:	150,000 Kms	Service History:	No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key**

S = Scratch    R = Rust    C = Crack    \* = Decals    W = Significant scuffs  
 D = Dent    PT = Paint defect    P = Pin dent    SC = Stone Chips

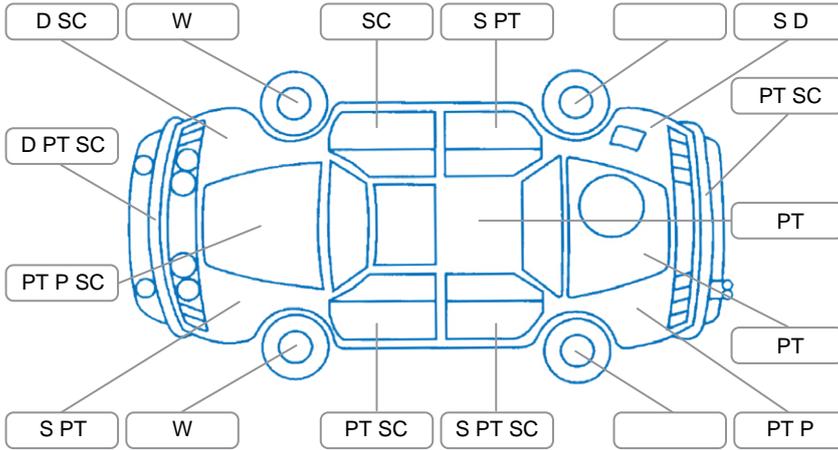

Note: some defects and blemishes may not be displayed in the diagram

**Body Inspection Comments**

- Rust in boot lid jamb
- Stone chip in front windscreen
- Front bumper lower trim needs to be re-secured

Conditions During Body Inspection    Dry

**Under Carriage and Under Bonnet Inspection Comments**

- 2WD
- Surface rust on top radiator support panel. Underside of vehicle rusty

**Interior Comments**

Seats:	Average
Carpets:	Average
Panels:	Average
Dashboard:	Average

**General Comments**

- Two key remotes, one isn't working
- Reversing camera picture quality poor
- Belt squeal on start up and rattle from engine
- Front left window gets stuck when winding down to bottom and trying to wind back up

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Timing Chain
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input type="checkbox"/> No    Kms

Inspected by:	Hoani Saunders
Published by:	Brad Lucas
Inspection Date:	18 Mar 2026

	OK	Requires Attention	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise		✓	
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand brake	✓		
<b>Tyres (lowest observed tread depth of tyres)</b>			
Left front			3.1 mm
Right front			3.4 mm
Left rear			5.5 mm
Right rear			5.9 mm
Spare		Yes	
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL		✓	
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	4		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera		✓	

I have read and understood this condition guide:

NAME \_\_\_\_\_

SIGNATURE \_\_\_\_\_