

Report ID:	28,061,959	Version:	1
Created:	21 Mar 2026		


Make:	Ford	Model:	Ranger
Body Style:	Utility	Year:	2009
Rego No.:	RQR397	Rego Expiry:	23 Aug 2026
WoF Expiry:	02 Dec 2026	Odometer:	410,406 Kms
Good No.:	28061959	VIN:	MNALSFE909W829528
Next Service:	410,842 Kms	Service History:	Yes

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

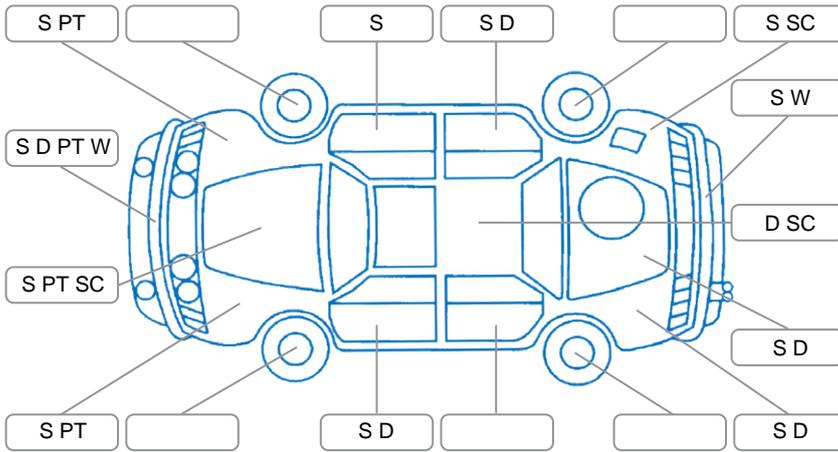

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

- Rust in boot lid jamb
- Hole in front left guard flare
- Paint defect front door jambs
- Front right park light isn't working

Conditions During Body Inspection: Dry

Under Carriage and Under Bonnet Inspection Comments

- 4WD
- Oil weep and seepage
- Front left outer C.V boot needs to be re-secured
- Surface rust on underside of bonnet and underside of vehicle

Interior Comments

Seats:	Average
Carpets:	Average
Panels:	Average
Dashboard:	Average

General Comments

- Partial service history
- Unable to read change of cambelt evidence sticker

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Cambelt
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input type="checkbox"/> No Kms
Inspected by:	Hoani Saunders
Published by:	Robert Chardon
Inspection Date:	20 Mar 2026

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation		✓	
Noise	✓		
Clutch	✓		
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			4.1 mm
Right front			3.7 mm
Left rear			1.0 mm
Right rear			1.4 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation		✓	
Electrical / Accessories			
Head lights		✓	
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	2		
Central locking	✓		
Remote locking			✓
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood this condition guide:

NAME _____

SIGNATURE _____