


Report ID:	28,063,409	Version:	3
Created:	30 Mar 2026		

Make:	Mitsubishi	Model:	Triton
Body Style:	Utility	Year:	2020
Rego No.:	MUP685	Rego Expiry:	14 Apr 2026
WoF Expiry:	15 Jul 2026	Odometer:	136,285 Kms
Good No.:	28063409	VIN:	MMAJLKL10LH010926
Next Service:	136,000 kms	Service History:	No

Note: This report is not a warranty
 This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key
 S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

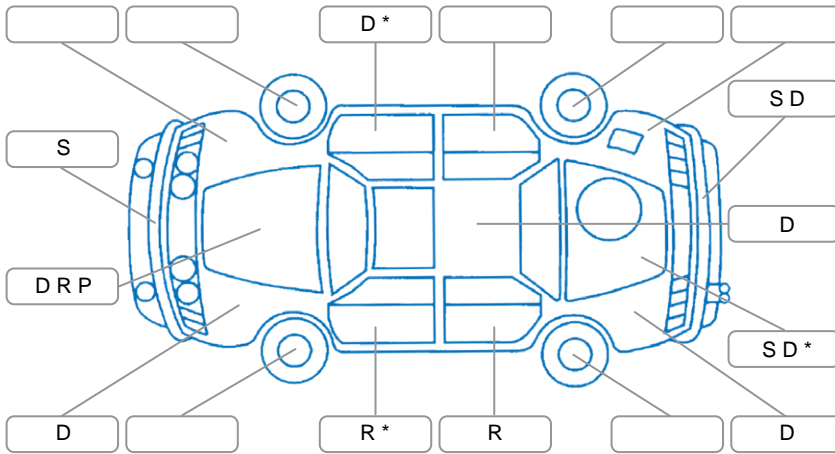

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Missing spare wheel tools, tail gate missing badge, front bumper refit, underbody rust, L front tyre low, service due.

Conditions During Body Inspection: Dry

Under Carriage and Under Bonnet Inspection Comments

L wing mirror broken.

Interior Comments

Seats:	Average
Carpets:	Average
Panels:	Average
Dashboard:	Good

General Comments

R front indicator glass cracked, interior driver door handle plastic cover missing, windscreen cracked cva, fitted with gps, middle air vent broken,

Road Conditions During Test Drive	Dry		
Engine Timing Mechanism	Timing Chain		
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes	<input type="checkbox"/> No	Kms
Inspected by:	Marlon Espena		
Published by:	Henry Manders		
Inspection Date:	24 Mar 2026		

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			4.0 mm
Right front			5.0 mm
Left rear			3.0 mm
Right rear			3.0 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera	✓		

I have read and understood this condition guide:

NAME _____

SIGNATURE _____