


Report ID:	28,068,694	Version:	1
Created:	27 Mar 2026		

Make:	Toyota	Model:	Hilux
Body Style:	Utility	Year:	2007
Rego No.:	NMB56	Rego Expiry:	19 May 2026
WoF Expiry:	13 Jun 2026	Odometer:	281,871 Kms
Good No.:	28068694	VIN:	MR0FZ29G601541240
Next Service:	300,000	Service History:	No

Note: This report is not a warranty
 This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key
 S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

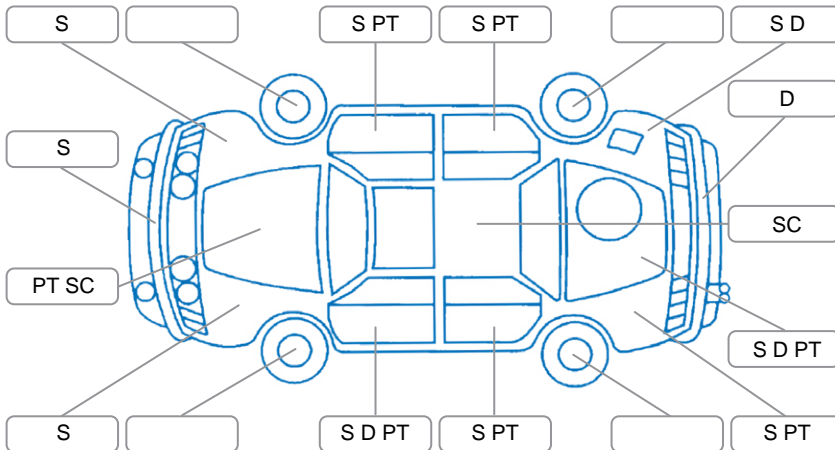

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Aftermarket nudge bar,snorkel,roof racks,minor stone chips on windscreen one possibly needs repairing,

Conditions During Body Inspection Wet

Under Carriage and Under Bonnet Inspection Comments

RHF outer CVboot half missing Leaking grease,lh inner cv boot split,lhr axle seal leaking causing lhr wheel to lock up when braking,alot of surface rust on underbody,

Interior Comments

Seats:	seats look average but do have seat covers on
Carpets:	Good
Panels:	Average
Dashboard:	Average

General Comments

Navigation is there couldn't get the maps up on screen,missing cup holder cover on dash,steering wheel cover ripped,lhf door cloth trim coming off,missing rear cup holders,RHR taillight lens cracked,has side steps in back tray,couldn't get spot lights to go,

Road Conditions During Test Drive	Wet	
Engine Timing Mechanism	Cambelt	
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes	<input checked="" type="checkbox"/> No
Inspected by:	Janine Bell	
Published by:	Holden Milne-Smith	
Inspection Date:	27 Mar 2026	

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch	✓		
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			2.5 mm
Right front			2.8 mm
Left rear			2.5 mm
Right rear			2.0 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	3		
Central locking	✓		
Remote locking		✓	
Sat. nav. (basic test only)		✓	
Reversing camera			✓

I have read and understood this condition guide: **NAME** _____

SIGNATURE _____