

Report ID:	28,073,391	Version:	1
Created:	01 Apr 2026		


Make:	Toyota	Model:	Corolla
Body Style:	Hatchback	Year:	2006
Rego No.:	DPT52	Rego Expiry:	28 Aug 2026
WoF Expiry:		Odometer:	257,233 Kms
Good No.:	28073391	VIN:	JTDKR22E900259105
Next Service:	267,800km's	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

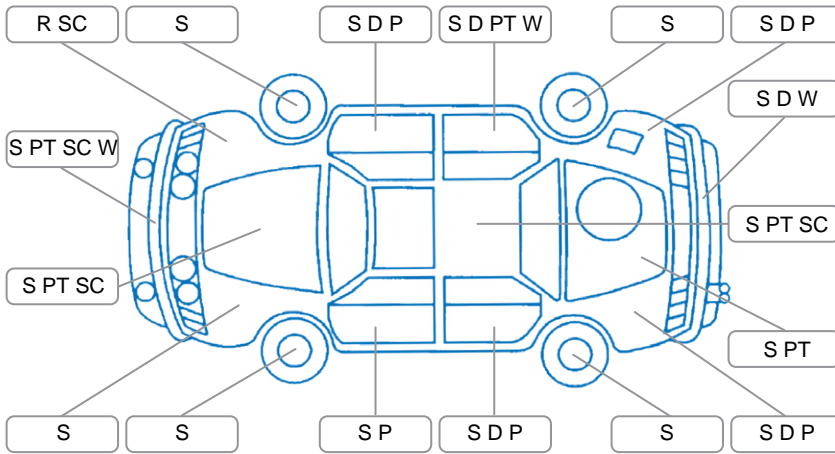

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Bonnet is not aligning correctly, cover hanging front grille panel & right side panel gap is large & not straight. Right front headlight top mounting brackets are broken. Paint clear coat peeling off bonnet. Plastic corner trim in left front bumper is missing. Left front bumper not fitting correctly

Conditions During Body Inspection: Wet Dry

Under Carriage and Under Bonnet Inspection Comments

Dent in right rear sill. Stone guard missing from under front bumper.

Interior Comments

Seats:	Good
Carpets:	Good
Panels:	Good
Dashboard:	Good

General Comments

Right front headlight is not working on low beam. Boot parcel trays cords have been replaced with shoe laces for holding tray up. Radio aerial is bent. Right side sun visor mirror is cracked & broken

Road Conditions During Test Drive	Dry		
Engine Timing Mechanism	Timing Chain		
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes	<input type="checkbox"/> No	Kms
Inspected by:	Jason Young		
Published by:	Glen Charlton		
Inspection Date:	31 Mar 2026		

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			7.0 mm
Right front			7.0 mm
Left rear			7.0 mm
Right rear			7.0 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights		✓	
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking		✓	
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood this condition guide:

NAME _____

SIGNATURE _____