

Report ID:	28,076,190	Version:	1
Created:	25 Mar 2026		


Make:	Toyota	Model:	Landcruiser
Body Style:	Wagon	Year:	1992
Rego No.:	XP8525	Rego Expiry:	31 May 2026
WoF Expiry:	13 May 2026	Odometer:	381,397 Kms
Good No.:	28076190	VIN:	7A8H60H0798022337
Next Service:	388,506	Service History:	No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

### Key

S = Scratch    R = Rust    C = Crack    \* = Decals    W = Significant scuffs  
 D = Dent    PT = Paint defect    P = Pin dent    SC = Stone Chips

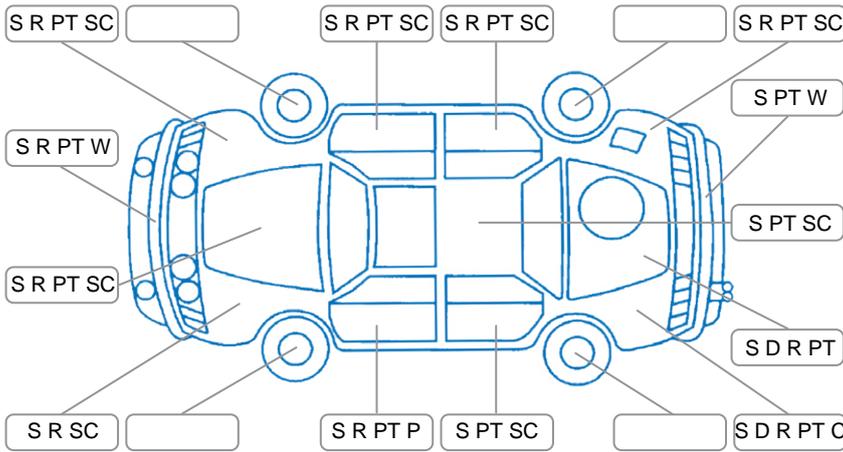

Note: some defects and blemishes may not be displayed in the diagram

### Body Inspection Comments

Rust on inner lower edge of left front door. Left taillight cracked. Spare wheel not roadworthy

Conditions During Body Inspection

Dry

### Under Carriage and Under Bonnet Inspection Comments

Oil leak. Left front knuckle leak. Transfer case leak. Rust on sill seams. Underbody surface rust. Modified exhaust.

### Interior Comments

Seats:	Poor
Carpets:	Poor
Panels:	Poor
Dashboard:	Poor

### General Comments

Multiple interior parts worn, damaged, or missing.  
 Lumpy idle. Turbo timer fitted. Play in steering, not aligned. Brakes spongy. Intermittent clunk from transmission.

Road Conditions During Test Drive	Dry	
Engine Timing Mechanism	Cambelt	
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes	<input checked="" type="checkbox"/> No
Inspected by:	Darren Beban	
Published by:	Darren Beban	
Inspection Date:	25 Mar 2026	

	OK	Requires Attention	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes		✓	
Engine performance		✓	
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation		✓	
Noise	✓		
Clutch			✓
CV joints			✓
Wheel bearings	✓		
<b>Brakes</b>			
Performance		✓	
Hand brake	✓		
<b>Tyres (lowest observed tread depth of tyres)</b>			
Left front			5.5 mm
Right front			5 mm
Left rear			7.5 mm
Right rear			8 mm
Spare		Yes	
<b>Suspension</b>			
Suspension performance	✓		
Steering performance		✓	
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation			✓
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR		✓	
Window winder RL		✓	
Window winder RR		✓	
Rear view mirrors		✓	
Radio (basic test only)		✓	
CD (basic test only)		✓	
Number of keys	2		
Central locking		✓	
Remote locking			✓
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood this condition guide:

NAME \_\_\_\_\_

SIGNATURE \_\_\_\_\_