

Report ID:	28,087,531	Version:	3
Created:	07 Apr 2026		


Make:	Toyota	Model:	Hiace
Body Style:	Minibus	Year:	2006
Rego No.:	HDZ906	Rego Expiry:	24 Apr 2026
WoF Expiry:	27 Mar 2027	Odometer:	270,079 Kms
Good No.:	28087531	VIN:	7AT0H60FX13005159
Next Service:	280, 083 Kms	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

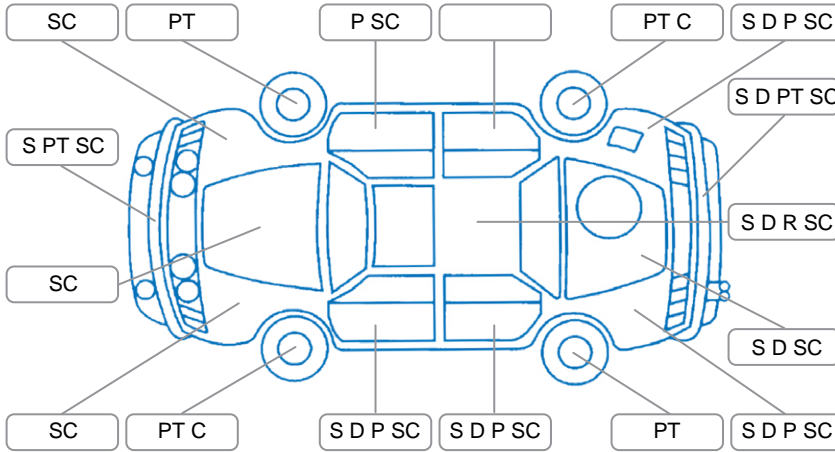

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Both front wheel arch/step plate panels worn. LH B pillar dented.
 Minor cracks and moisture in RH taillight. LH taillight cracked.
 LH cant rail dented/scraped. Rust on roof.
 Tailgate mirror missing. Missing tools. RH sill dented.

Conditions During Body Inspection Dry

Under Carriage and Under Bonnet Inspection Comments

Engine oil leak.
 Minor surface rust on radiator support.

Interior Comments

Seats:	Good
Carpets:	Average
Panels:	Average
Dashboard:	Average, small holes drilled in dash.

General Comments

Loud whine in driveline.

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Timing Chain
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input type="checkbox"/> No Kms
Inspected by:	Troy Smith
Published by:	Shanna Bullion
Inspection Date:	31 Mar 2026

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			8.5 mm
Right front			9.0 mm
Left rear			5.5 mm
Right rear			5.0 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL			✓
Window winder RR			✓
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	3		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood this condition guide:

NAME _____

SIGNATURE _____