


Report ID:	28,089,568	Version:	1
Created:	08 Apr 2026		

Make:	Mitsubishi	Model:	380
Body Style:	Sedan	Year:	2006
Rego No.:	DFS123	Rego Expiry:	28 Jun 2026
WoF Expiry:	21 Apr 2026	Odometer:	184,241 Kms
Good No.:	28089568	VIN:	6MMDB4V415T001668
Next Service:	no sticker	Service History:	No

Note: This report is not a warranty
 This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key
 S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

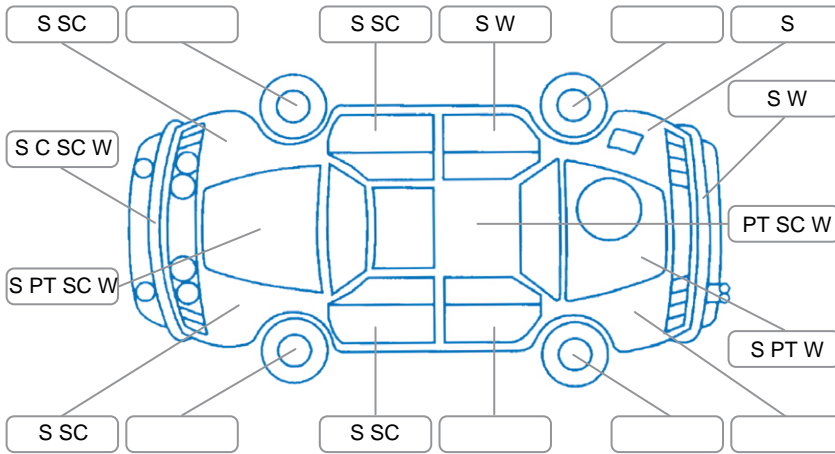

Note: some defects and blemishes may not be displayed in the diagram

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)		✓	
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance		✓	
Hand brake		✓	
Tyres (lowest observed tread depth of tyres)			
Left front			5.0 mm
Right front			5.0 mm
Left rear			4.0 mm
Right rear			4.0 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys		2	
Central locking	✓		
Remote locking		✓	
Sat. nav. (basic test only)			✓
Reversing camera			✓

Body Inspection Comments

Conditions During Body Inspection	Dry
-----------------------------------	-----

Under Carriage and Under Bonnet Inspection Comments

Signs of coolant leaks around upper rad hose/rad top tank. Engine oil leaks.

Interior Comments

Seats:	Average
Carpets:	Average
Panels:	Average
Dashboard:	Average

General Comments

Key FOBS intermittently NW. Hood lining sagging. Hand brake travel excessive.

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Cambelt
Evidence of Cam Belt Replacement	<input checked="" type="checkbox"/> Yes <input type="checkbox"/> No 173,725 Kms
Inspected by:	Robert Rankin
Published by:	Luke Saunders
Inspection Date:	07 Apr 2026

I have read and understood this condition guide: **NAME** _____

SIGNATURE _____