


Report ID:	28,104,766	Version:	1
Created:	10 Apr 2026		

Make:	Toyota	Model:	Landcruiser Prado
Body Style:	Wagon	Year:	1997
Rego No.:	FMJ130	Rego Expiry:	24 Apr 2026
WoF Expiry:	11 Oct 2026	Odometer:	406,076 Kms
Good No.:	28104766	VIN:	7A8H60H0704037721
Next Service:	410,000kms	Service History:	No

**Note: This report is not a warranty**  
 This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key**  
 S = Scratch    R = Rust    C = Crack    \* = Decals    W = Significant scuffs  
 D = Dent    PT = Paint defect    P = Pin dent    SC = Stone Chips

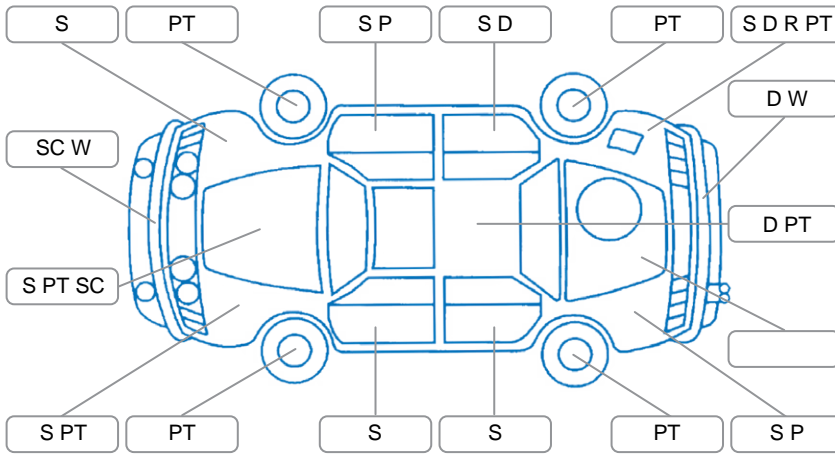

Note: some defects and blemishes may not be displayed in the diagram

### Body Inspection Comments

8seater. Right head light has stone cracks. Screw holes on front bumper. Paint is flaking on left front guard and rear bumper. Right tail light is cracked. DIY paint on roof. Minor stone chips and cracks on windshield. Rear badge (TX) is missing.

Conditions During Body Inspection: Dry

### Under Carriage and Under Bonnet Inspection Comments

### Interior Comments

Seats:	Average
Carpets:	Average
Panels:	Average
Dashboard:	Average

### General Comments

Coolant is dirty. Radiator flash required. Centre console lid is broken. Right front and rear door, tail gate trims are torn. Left front seat back pocket is torn. Right front seat base pad is torn.

Road Conditions During Test Drive	Dry		
Engine Timing Mechanism	Cambelt		
Evidence of Cam Belt Replacement	<input checked="" type="checkbox"/> Yes	<input type="checkbox"/> No	349,382 Kms
Inspected by:	Yuki Itohara		
Published by:	Callum Busuttil		
Inspection Date:	09 Apr 2026		

	OK	Requires Attention	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition		✓	
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand brake	✓		
<b>Tyres (lowest observed tread depth of tyres)</b>			
Left front			5.0 mm
Right front			6.0 mm
Left rear			5.5 mm
Right rear			6.0 mm
Spare		Yes	
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	2		
Central locking	✓		
Remote locking			✓
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood this condition guide:

NAME \_\_\_\_\_

SIGNATURE \_\_\_\_\_