


Report ID:	28,107,700	Version:	4
Created:	29 Apr 2026		

Make:	Mazda	Model:	Bt-50
Body Style:	Utility	Year:	2018
Rego No.:	LHK359	Rego Expiry:	29 Jul 2026
WoF Expiry:	19 Apr 2026	Odometer:	157,162 Kms
Good No.:	28107700	VIN:	MMOUR0YG100808265
Next Service:	159000	Service History:	Yes

Note: This report is not a warranty
 This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key
 S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

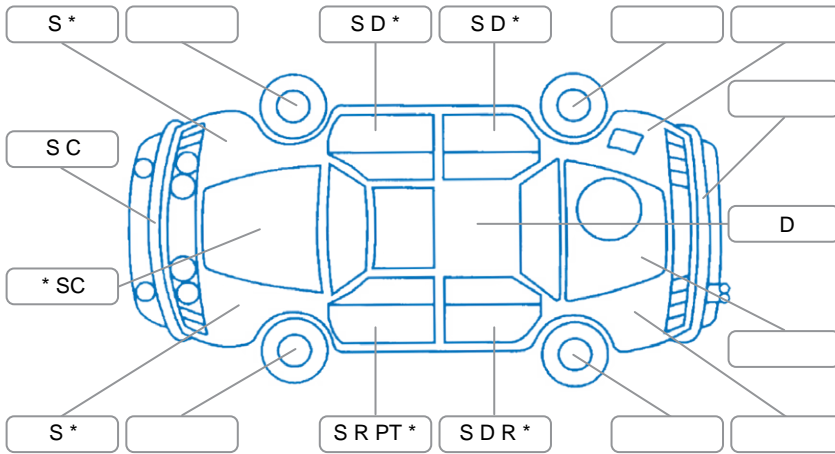

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Fan switch missing, Centre console trim need to refit, both taillight moist, front bumper needs to refit and plastic cover missing, front bumper grill garnish broken, both headlights faded, rear left wheel centre cup missing, rear right mud flap unsecure, left side mirror cracked, right sill step part of interior missing

Conditions During Body Inspection

Under Carriage and Under Bonnet Inspection Comments

Underbody surface rust, front bar support bent,

Interior Comments

Seats:	driver seat torn,
Carpets:	Average
Panels:	driver side door panel cover missing,
Dashboard:	Average

General Comments

rear bumper parking sensor needs refit, rear left seat belt frayed, right front door seal torn,

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Timing Chain
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input type="checkbox"/> No Kms
Inspected by:	Curshey Accad
Published by:	Darryl Kereti
Inspection Date:	18 Apr 2026

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			4.0 mm
Right front			10.0 mm
Left rear			2.0 mm
Right rear			10.0 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights		✓	
Tail lights		✓	
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL			✓
Window winder RR			✓
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera	✓		

I have read and understood this condition guide:

NAME _____

SIGNATURE _____