


Report ID:	28,108,897	Version:	2
Created:	11 Apr 2026		

Make:	Toyota	Model:	Landcruiser Prado
Body Style:	SUV	Year:	2010
Rego No.:	FRG231	Rego Expiry:	31 May 2026
WoF Expiry:	14 Jan 2027	Odometer:	286,461 Kms
Good No.:	28108897	VIN:	JTEBH3FJ40K037541
Next Service:	292000	Service History:	Yes

**Note: This report is not a warranty**  
 This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key**  
 S = Scratch    R = Rust    C = Crack    \* = Decals    W = Significant scuffs  
 D = Dent    PT = Paint defect    P = Pin dent    SC = Stone Chips

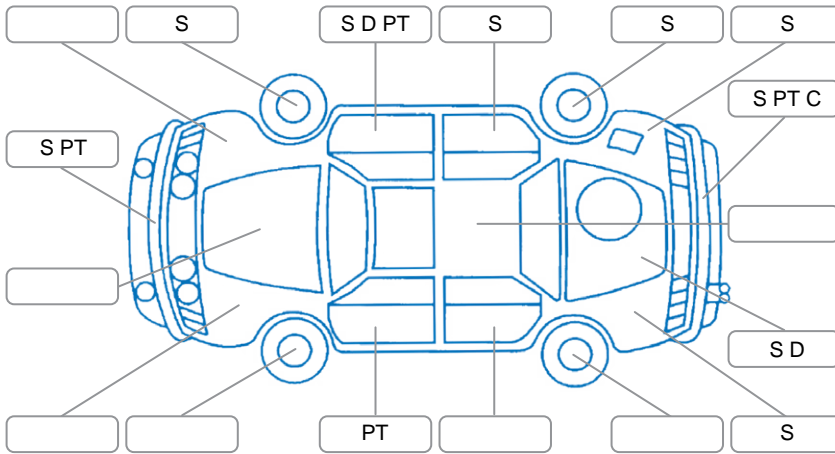

Note: some defects and blemishes may not be displayed in the diagram

### Body Inspection Comments

Windscreen crack outside cva, center console armrest torn, steering wheel worn, bonnet guard damaged, right rear window seal torn, left front air vent tab missing, front bumper lower grill needs to refit

Conditions During Body Inspection

### Under Carriage and Under Bonnet Inspection Comments

Engine oil leak, right inner cv boot leak, underbody rust, lower arm bushes split, right running board bent,

### Interior Comments

Seats:	driver seat torn,
Carpets:	Average
Panels:	Average
Dashboard:	Average

### General Comments

Battery flat,

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Timing Chain
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input type="checkbox"/> No    Kms
Inspected by:	Curshey Accad
Published by:	Curshey Accad
Inspection Date:	11 Apr 2026

	OK	Requires Attention	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand brake	✓		
<b>Tyres (lowest observed tread depth of tyres)</b>			
Left front			6 mm
Right front			6 mm
Left rear			7 mm
Right rear			7 mm
Spare		Yes	
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys		2	
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)	✓		
Reversing camera	✓		

I have read and understood this condition guide:

NAME \_\_\_\_\_

SIGNATURE \_\_\_\_\_