

Report ID:	28,113,814	Version:	1
Created:	15 Apr 2026		


Make:	Mazda	Model:	Axela
Body Style:	Hatchback	Year:	2010
Rego No.:	LBZ300	Rego Expiry:	06 May 2026
WoF Expiry:	27 Apr 2027	Odometer:	215,344 Kms
Good No.:	28113814	VIN:	7AT0C13JX15114506
Next Service:	225,341km's	Service History:	No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

### Key

S = Scratch    R = Rust    C = Crack    \* = Decals    W = Significant scuffs  
 D = Dent    PT = Paint defect    P = Pin dent    SC = Stone Chips

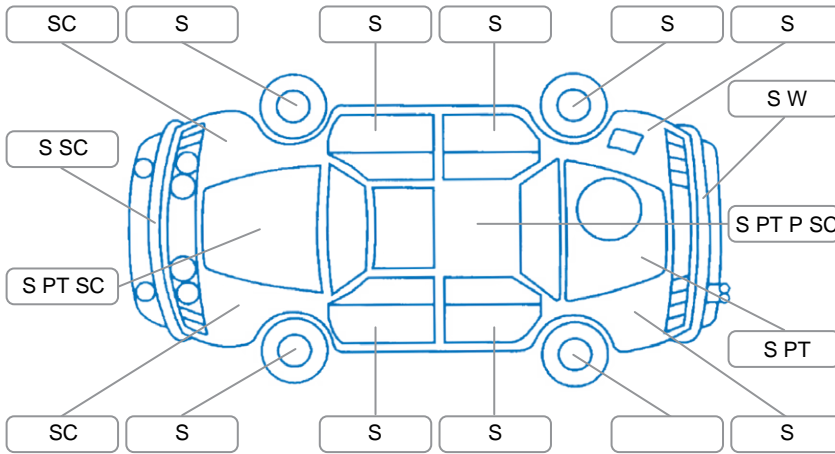

Note: some defects and blemishes may not be displayed in the diagram

### Body Inspection Comments

Plastic cover missing off rear window wiper arm. Heavy scratches in inside of driver's door frame. Left side wing mirror repeater lens is cracked. Small stone crack in right side of windscreen.

Conditions During Body Inspection	Dry
-----------------------------------	-----

### Under Carriage and Under Bonnet Inspection Comments

Right front top engine mount is soft, needs replacing. Left front inner guard panel has front part broken off & missing. Left front stone guard panel is missing from under front bumper.

### Interior Comments

Seats:	Good
Carpets:	Good
Panels:	Good
Dashboard:	Good

### General Comments

Radio controls on steering wheel don't work as has a aftermarket radio fitted. Fabric torn in middle of base pad on rear seat.

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Timing Chain
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input type="checkbox"/> No    Kms
Inspected by:	Jason Young
Published by:	Glen Charlton
Inspection Date:	14 Apr 2026

	OK	Requires Attention	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand brake	✓		
<b>Tyres (lowest observed tread depth of tyres)</b>			
Left front			4.0 mm
Right front			4.0 mm
Left rear			4.0 mm
Right rear			4.0 mm
Spare		N/A	
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood this condition guide:

NAME \_\_\_\_\_

SIGNATURE \_\_\_\_\_