

Report ID:	28,121,022	Version:	1
Created:	15 Apr 2026		


Make:	Mitsubishi	Model:	380
Body Style:	Sedan	Year:	2006
Rego No.:	MYC999	Rego Expiry:	20 Jun 2026
WoF Expiry:	15 Apr 2026	Odometer:	267,969 Kms
Good No.:	28121022	VIN:	6MMDB4D415T005200
Next Service:	Overdue.	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

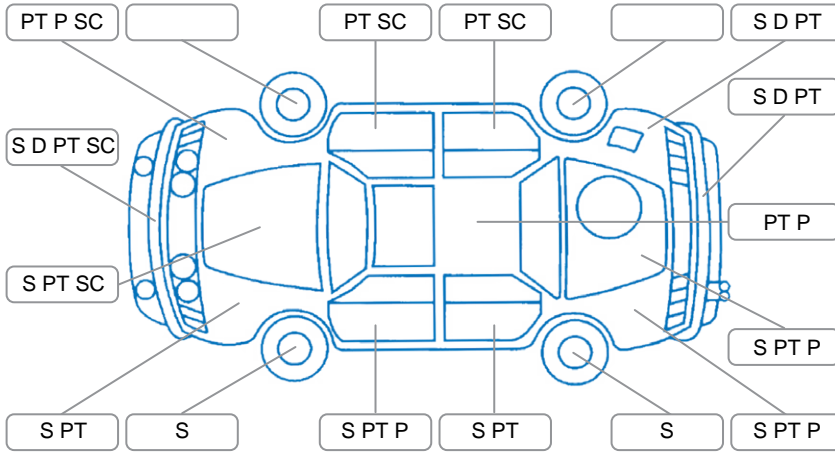

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Rear left tail light cover broken. Front left tyre outside edge worn.
 Wing mirror covers are different colours. Front right tyre inside edge worn.
 Paint faded and peeling on all panels.
 Boot mat damaged.

Conditions During Body Inspection	Dry
-----------------------------------	-----

Under Carriage and Under Bonnet Inspection Comments

Oil leaks.

Interior Comments

Seats:	Poor
Carpets:	Average
Panels:	Average
Dashboard:	Average

General Comments

2WD. A/C not pushing cold air.
 Engine ticking. Drivers seat belt does not retract as normal.
 Interior mirror beginning to delaminate. Central locking fault.
 Only one key starts car. Key start fault.

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Cambelt
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input checked="" type="checkbox"/> No Kms
Inspected by:	Flynn Burdon
Published by:	Kieran Driver
Inspection Date:	15 Apr 2026

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			3.1 mm
Right front			3.8 mm
Left rear			3.4 mm
Right rear			3.7 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation		✓	
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	2		
Central locking		✓	
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood this condition guide:

NAME _____

SIGNATURE _____