

Report ID:	28,133,572	Version:	3
Created:	28 Apr 2026		


Make:	Toyota	Model:	Hiace
Body Style:	Minibus	Year:	2006
Rego No.:	LAK606	Rego Expiry:	08 Oct 2026
WoF Expiry:	09 Sep 2026	Odometer:	357,177 Kms
Good No.:	28133572	VIN:	7AT0H60FX17549254
Next Service:	322301 kms	Service History:	No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

### Key

S = Scratch    R = Rust    C = Crack    \* = Decals    W = Significant scuffs  
 D = Dent    PT = Paint defect    P = Pin dent    SC = Stone Chips

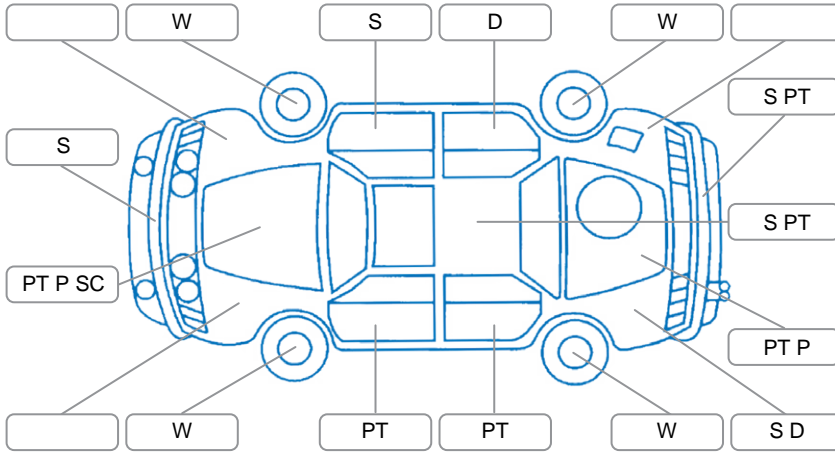

Note: some defects and blemishes may not be displayed in the diagram

### Body Inspection Comments

Fog lights lens fogging. Driver seatbelt beginning to fray. Dash holes and missing trim pieces.

Conditions During Body Inspection	Dry
-----------------------------------	-----

### Under Carriage and Under Bonnet Inspection Comments

Steering rack oil stains. Engine oil stains/leaks. Radiator support surface rust. Drivebelt cracking. Front brake pads appear low. Aftermarket lights and wiring underbody.

### Interior Comments

Seats:	Average
Carpets:	Poor
Panels:	Poor
Dashboard:	Poor

### General Comments

10 seats. Gear knob missing. Aftermarket speakers. Loose and exposed wiring throughout vehicle. Minor engine misfire. A/C controls stiff and loose. W/S crack in CVA. Steering wheel off centre. Suspension creaks.

Road Conditions During Test Drive	Wet
Engine Timing Mechanism	Timing Chain
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input type="checkbox"/> No    Kms
Inspected by:	Eleoit Kumar
Published by:	Sam Huang
Inspection Date:	24 Apr 2026

	OK	Requires Attention	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints			✓
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand brake	✓		
<b>Tyres (lowest observed tread depth of tyres)</b>			
Left front			7.0 mm
Right front			7.0 mm
Left rear			4.0 mm
Right rear			4.0 mm
Spare		Yes	
<b>Suspension</b>			
Suspension performance		✓	
Steering performance		✓	
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL			✓
Window winder RR			✓
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood this condition guide:

NAME \_\_\_\_\_

SIGNATURE \_\_\_\_\_