


Report ID:	28,138,755	Version:	1
Created:	23 Apr 2026		

Make:	Nissan	Model:	Tiida
Body Style:	Hatchback	Year:	2005
Rego No.:	LFM306	Rego Expiry:	05 Jun 2026
WoF Expiry:		Odometer:	151,517 Kms
Good No.:	28138755	VIN:	7AT0DH78X18003278
Next Service:	Unknown.	Service History:	No

**Note: This report is not a warranty**  
 This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key**  
 S = Scratch    R = Rust    C = Crack    \* = Decals    W = Significant scuffs  
 D = Dent    PT = Paint defect    P = Pin dent    SC = Stone Chips

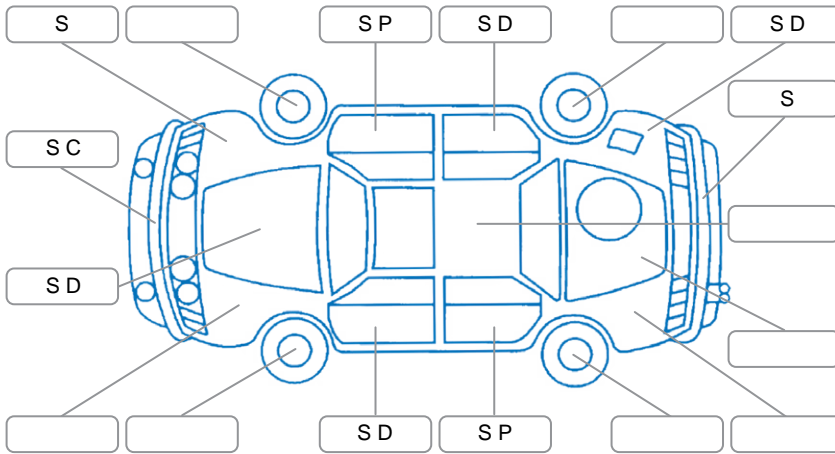

Note: some defects and blemishes may not be displayed in the diagram

### Body Inspection Comments

- Front bumper clips broken left side, cannot be refitted.
- Hole in front bumper.
- Rear left side of bumper not aligned with fender.
- Left wing mirror paint defect.

Conditions During Body Inspection    Dry

### Under Carriage and Under Bonnet Inspection Comments

### Interior Comments

Seats:	Poor
Carpets:	Average
Panels:	Average
Dashboard:	Average

### General Comments

- Rear wiper blade faulty.    A/C blows warm.
- Arm rest leather ripped.    Oil low.
- Drivers seat missing side plastics.
- Reversing camera foggy.

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Timing Chain
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input type="checkbox"/> No    Kms
Inspected by:	Kees Gould
Published by:	Nitiphum Yordsiri
Inspection Date:	23 Apr 2026

	OK	Requires Attention	N/A
<b>Engine</b>			
Oil level		✓	
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand brake	✓		
<b>Tyres (lowest observed tread depth of tyres)</b>			
Left front			3.5 mm
Right front			5.1 mm
Left rear			3.9 mm
Right rear			4.9 mm
Spare		Yes	
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation		✓	
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)		✓	
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera		✓	

I have read and understood this condition guide:

NAME \_\_\_\_\_

SIGNATURE \_\_\_\_\_