

Report ID:	28,139,709	Version:	4
Created:	05 May 2026		


Make:	Mitsubishi	Model:	Triton
Body Style:	Utility	Year:	2019
Rego No.:	MKE177	Rego Expiry:	22 Jun 2026
WoF Expiry:	19 Sep 2026	Odometer:	241,556 Kms
Good No.:	28139709	VIN:	MMAJLKK10KH015535
Next Service:	237,700kms	Service History:	No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

### Key

S = Scratch    R = Rust    C = Crack    \* = Decals    W = Significant scuffs  
 D = Dent    PT = Paint defect    P = Pin dent    SC = Stone Chips

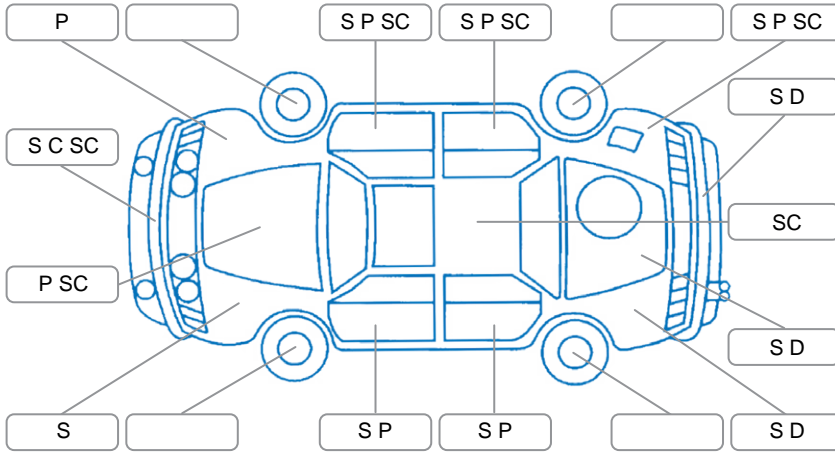

Note: some defects and blemishes may not be displayed in the diagram

### Body Inspection Comments

Both side running boards are scuffed and paint is flaking. Both sill paint is worn. Canopy back door seal rubber is torn. Left headlight coating is damaged. Rear bumper alignment required. Screw holes inside of right front guard. Tail gate is jammed. Edge of Right tail light is cracked.

Conditions During Body Inspection: Dry

### Under Carriage and Under Bonnet Inspection Comments

Leaking from around transmission.

### Interior Comments

Seats: Driver's seat is worn and torn.

Carpets: Average

Panels: Average

Dashboard: Average

### General Comments

Right front air vent is broken. Paint of centre console is worn. Screw holes in left side of centre console. Minor dents in cab corners.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain

Evidence of Cam Belt Replacement:  Yes  No      Kms

Inspected by: Yuki Itohara

Published by: Yuki Itohara

Inspection Date: 05 May 2026

	OK	Requires Attention	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand brake	✓		
<b>Tyres (lowest observed tread depth of tyres)</b>			
Left front			2 mm
Right front			3.5 mm
Left rear			2 mm
Right rear			3 mm
Spare		Yes	
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera	✓		

I have read and understood this condition guide:

NAME \_\_\_\_\_

SIGNATURE \_\_\_\_\_