

Report ID:	28,146,067	Version:	1
Created:	29 Apr 2026		


Make:	Mitsubishi	Model:	Outlander
Body Style:	Wagon	Year:	2006
Rego No.:	JKQ357	Rego Expiry:	16 May 2026
WoF Expiry:	09 Sep 2026	Odometer:	104,818 Kms
Good No.:	28146067	VIN:	7AT0CJ3MX15100994
Next Service:	111,800 Kms	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

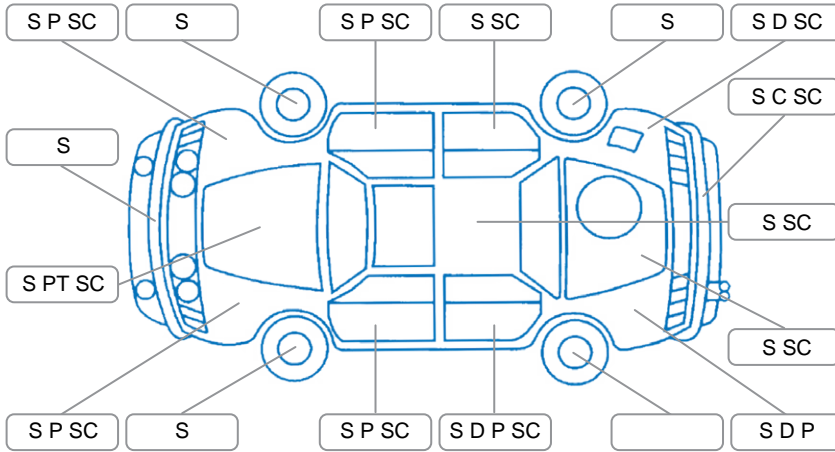

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Front bumper fits poorly on RH side. RH roof gutter moulding needs refitted.
 Paint defect on door handles and LF guard mirror. LF inner guard liner damaged.
 FR sill step plate worn.
 Aerial in poor condition.

Conditions During Body Inspection	Dry
-----------------------------------	-----

Under Carriage and Under Bonnet Inspection Comments

RF axle seal leaking.
 Fuel tank dented.

Interior Comments

Seats:	Good
Carpets:	Good
Panels:	Average
Dashboard:	Average, steering wheel worn.

General Comments

Rear wiper blade needs replaced.
 Third row seats spring covers missing.
 RH park light not working.
 Suspension knocks.

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Timing Chain
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input type="checkbox"/> No Kms
Inspected by:	Troy Smith
Published by:	Troy Smith
Inspection Date:	29 Apr 2026

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			5.5 mm
Right front			4.5 mm
Left rear			6.5 mm
Right rear			7 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights		✓	
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera	✓		

I have read and understood this condition guide:

NAME _____

SIGNATURE _____