


Report ID:	28,159,542	Version:	1
Created:	08 May 2026		

Make:	Mazda	Model:	Axela
Body Style:	Hatchback	Year:	2011
Rego No.:	KSN560	Rego Expiry:	14 Jan 2027
WoF Expiry:	31 May 2026	Odometer:	159,056 Kms
Good No.:	28159542	VIN:	7AT0C13JX17115859
Next Service:	154,500kms	Service History:	No

Note: This report is not a warranty
 This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key
 S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

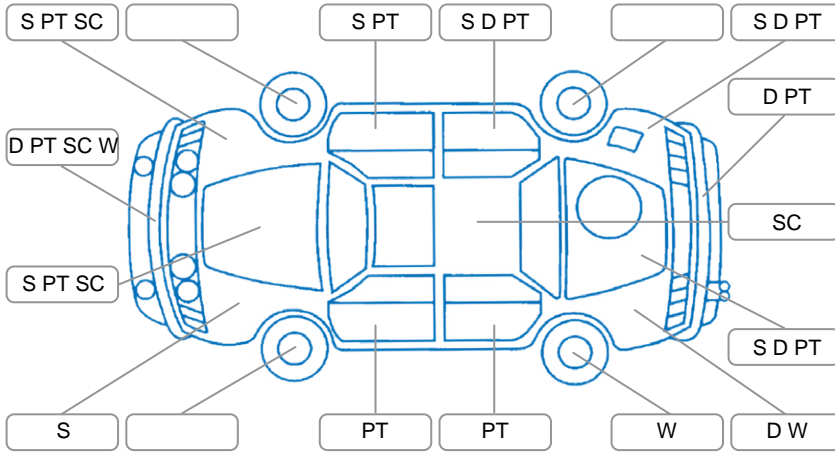

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Service is overdue. Paint is cracked on rear bumper. DIY spray around body panels. Tail gate opener switch surround is damaged. Left door mirror repeater is broken. Factory puncture kit is missing. Minor dents and scratches on right B pillar.

Conditions During Body Inspection: Dry

Under Carriage and Under Bonnet Inspection Comments

Interior Comments

Seats:	Good
Carpets:	Good
Panels:	Good
Dashboard:	Head damage in middle.

General Comments

i-stop warning light is blinking (New acc battery required).
 Steering audio control is not connected to aftermarket unit. Suspension bushes are worn.

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Timing Chain
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input type="checkbox"/> No Kms

Inspected by:	Yuki Itohara
Published by:	Nick Beaton
Inspection Date:	04 May 2026

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			2.0 mm
Right front			3.0 mm
Left rear			3.0 mm
Right rear			4.0 mm
Spare		N/A	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators		✓	
Dashboard warning lights		✓	
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood this condition guide: **NAME** _____

SIGNATURE _____