

Report ID:	28,159,590	Version:	1
Created:	12 May 2026		


Make:	Mazda	Model:	Atenza
Body Style:	Sedan	Year:	2008
Rego No.:	PHJ910	Rego Expiry:	04 Apr 2026
WoF Expiry:	09 Apr 2027	Odometer:	207,779 Kms
Good No.:	28159590	VIN:	7AT0C139X13101788
Next Service:	215,781 Kms	Service History:	No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

### Key

S = Scratch    R = Rust    C = Crack    \* = Decals    W = Significant scuffs  
 D = Dent    PT = Paint defect    P = Pin dent    SC = Stone Chips

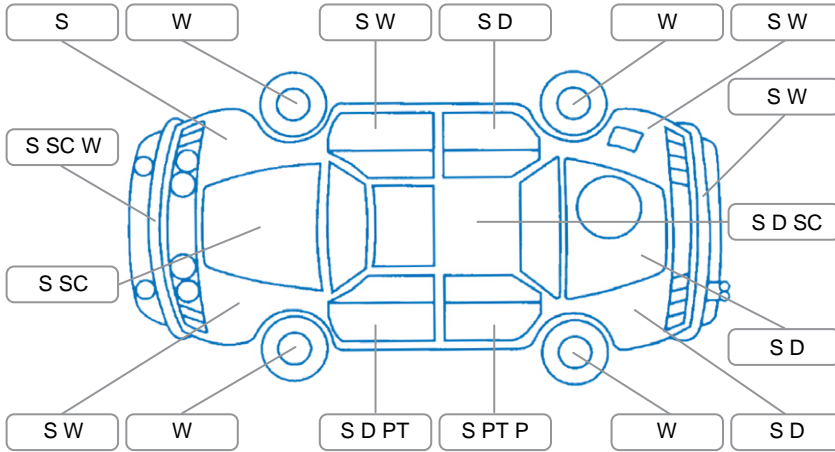

Note: some defects and blemishes may not be displayed in the diagram

### Body Inspection Comments

- Drivers door clicks when opening
- Side mirrors won't adjust
- Missing VIN cover on driver side floor
- Drivers door missing interior light

Conditions During Body Inspection:  Dry  Wet

### Under Carriage and Under Bonnet Inspection Comments

Front Wheel Drive

### Interior Comments

Seats:	Average
Carpets:	Average - Driverside carpet torn/worn
Panels:	Average
Dashboard:	Average

### General Comments

- Radio/speakers don't work
- Navigation not for NZ roads
- Boot/spare wheel well has slight rust
- Clicking coming from dash when vehicle starts

Road Conditions During Test Drive	Wet	
Engine Timing Mechanism	Timing Chain	
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input type="checkbox"/> No	Kms
Inspected by:	Logan Lane	
Published by:	Janine Bell	
Inspection Date:	09 May 2026	

	OK	Requires Attention	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand brake	✓		
<b>Tyres (lowest observed tread depth of tyres)</b>			
Left front			4.9 mm
Right front			5.1 mm
Left rear			5.8 mm
Right rear			6.1 mm
Spare		Yes	
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors		✓	
Radio (basic test only)		✓	
CD (basic test only)		✓	
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)		✓	
Reversing camera			✓

I have read and understood this condition guide:

NAME \_\_\_\_\_

SIGNATURE \_\_\_\_\_