

Report ID:	28,159,780	Version:	1
Created:	06 May 2026		


Make:	Volkswagen	Model:	Polo
Body Style:	Hatchback	Year:	2008
Rego No.:	KZQ842	Rego Expiry:	08 Mar 2027
WoF Expiry:	17 Apr 2027	Odometer:	113,128 Kms
Good No.:	28159780	VIN:	WVWZZZ9NZ7Y199505
Next Service:	119,300kms	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

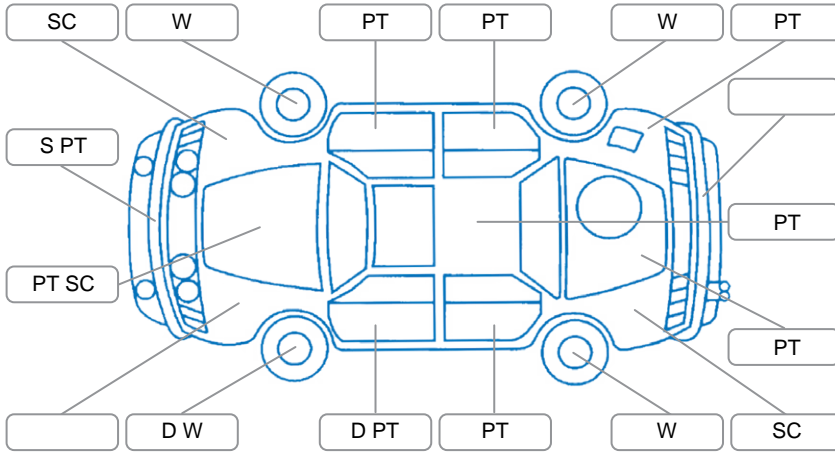

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Paint is cracked and flaking on front bumper. Right front wheel is buckled. Clear paint is flaking here and there. Rear wiper arm cap is missing. Right and left tail lights are cracked.

Conditions During Body Inspection	Dry
-----------------------------------	-----

Under Carriage and Under Bonnet Inspection Comments

Leaking from around engine and transmission. Welding of muffler hanger is broken. Aftermarket air intake and blow off.

Interior Comments

Seats:	Good
Carpets:	Average
Panels:	Clothes are sagging.
Dashboard:	Major cracks.

General Comments

Front fog light ps are disconnected as reflectors are faulty. Rear fog light is not operating. Tail gate gas struts are weak. Electric mirrors are not operating.

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Cambelt
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input checked="" type="checkbox"/> No Kms
Inspected by:	Yuki Itohara
Published by:	Glen Charlton
Inspection Date:	04 May 2026

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch	✓		
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			4.5 mm
Right front			5.0 mm
Left rear			3.0 mm
Right rear			3.5 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood this condition guide:

NAME _____

SIGNATURE _____