


Report ID:	28,166,029	Version:	2
Created:	10 Jun 2026		

Make:	Mitsubishi	Model:	Eclipse Cross
Body Style:	SUV	Year:	2022
Rego No.:	PGU975	Rego Expiry:	14 Aug 2026
WoF Expiry:	15 Aug 2026	Odometer:	77,947 Kms
Good No.:	28166029	VIN:	JMFXDGL3WNZ003430
Next Service:	93,000	Service History:	Yes

**Note: This report is not a warranty**  
 This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key**  
 S = Scratch    R = Rust    C = Crack    \* = Decals    W = Significant scuffs  
 D = Dent    PT = Paint defect    P = Pin dent    SC = Stone Chips

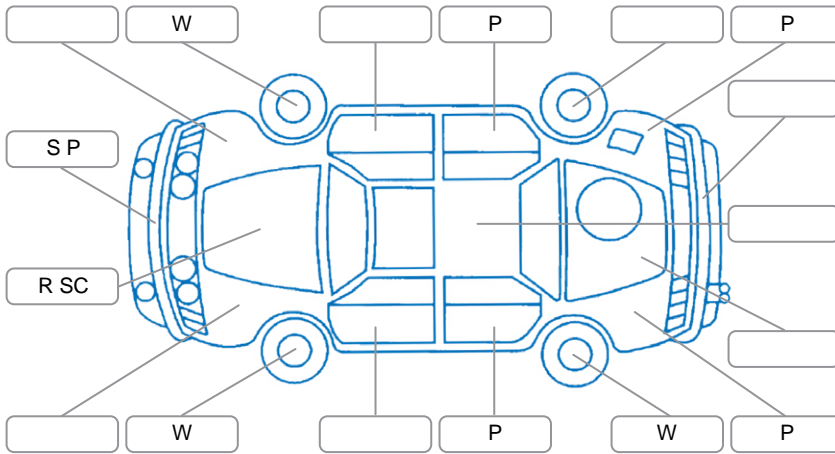

Note: some defects and blemishes may not be displayed in the diagram

	OK	Requires Attention	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand brake	✓		
<b>Tyres (lowest observed tread depth of tyres)</b>			
Left front			4.0 mm
Right front			4.0 mm
Left rear			6.0 mm
Right rear			3.0 mm
Spare		N/A	
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera	✓		

**Body Inspection Comments**

Conditions During Body Inspection: Dry

**Under Carriage and Under Bonnet Inspection Comments**

**Interior Comments**

Seats:	worn
Carpets:	Good
Panels:	Good
Dashboard:	cracked dashboard

**General Comments**

Has both commercial & domestic charging cables  
 Stained front Seats  
 Noise from steering rack (Requires further investigation)

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Timing Chain
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input type="checkbox"/> No    Kms
Inspected by:	Kilipati Mae
Published by:	Bruce Screaton
Inspection Date:	21 May 2026

I have read and understood this condition guide: **NAME** \_\_\_\_\_

**SIGNATURE** \_\_\_\_\_