

Report ID:	28,170,256	Version:	1
Created:	12 May 2026		


Make:	Ford	Model:	Ranger
Body Style:	Utility	Year:	2008
Rego No.:	ESL791	Rego Expiry:	13 May 2026
WoF Expiry:	05 May 2027	Odometer:	285,645 Kms
Good No.:	28170256	VIN:	MNAUSFE908W772241
Next Service:	?	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

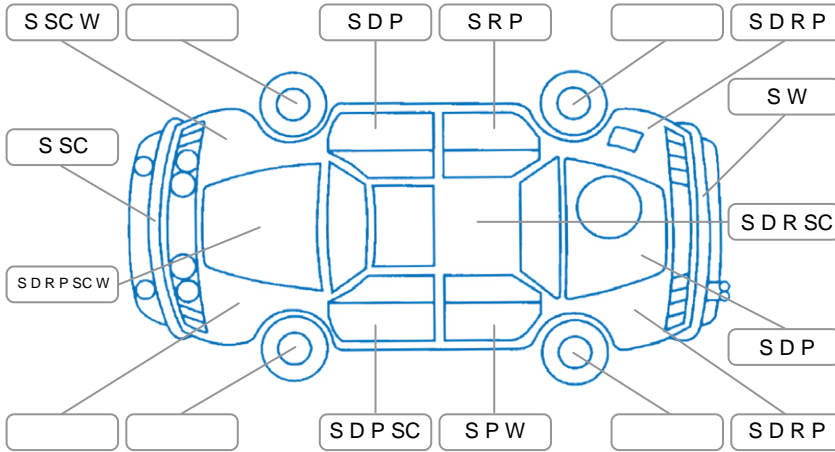

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Stone guard on front of bonnet is cracked & broken. Air intake snorkel is not hooked up, has pod filter fitted. Screw holes on inside lip of left front guard. Cracks in right rear taillight lens. Paint worn on top edge of right side sill & dent in sill under drivers door. Has no spare wheel.

Conditions During Body Inspection: Wet Dry

Under Carriage and Under Bonnet Inspection Comments

Oil leak from engine. Has no rear muffler on exhaust.

Interior Comments

Seats:	Good
Carpets:	Good
Panels:	Average
Dashboard:	Good

General Comments

Heater fan speed switch is missing. Cover missing that fits under steering column & that goes over fuse box.

Road Conditions During Test Drive	Dry		
Engine Timing Mechanism	Cambelt		
Evidence of Cam Belt Replacement	<input checked="" type="checkbox"/> Yes	<input type="checkbox"/> No	260,475 Kms
Inspected by:	Jason Young		
Published by:	Tiaan Pienaar		
Inspection Date:	11 May 2026		

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch	✓		
CV joints			✓
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			9.0 mm
Right front			10.0 mm
Left rear			10.0 mm
Right rear			10.0 mm
Spare		No	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood this condition guide:

NAME _____

SIGNATURE _____