

Report ID:	28,175,101	Version:	1
Created:	13 May 2026		


Make:	Mazda	Model:	E2000
Body Style:	Van	Year:	2007
Rego No.:	EDL908	Rego Expiry:	25 Oct 2026
WoF Expiry:	06 Oct 2026	Odometer:	293,209 Kms
Good No.:	28175101	VIN:	JM0SKY0E200304262
Next Service:	290,000km's	Service History:	No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key**

S = Scratch    R = Rust    C = Crack    \* = Decals    W = Significant scuffs  
 D = Dent    PT = Paint defect    P = Pin dent    SC = Stone Chips

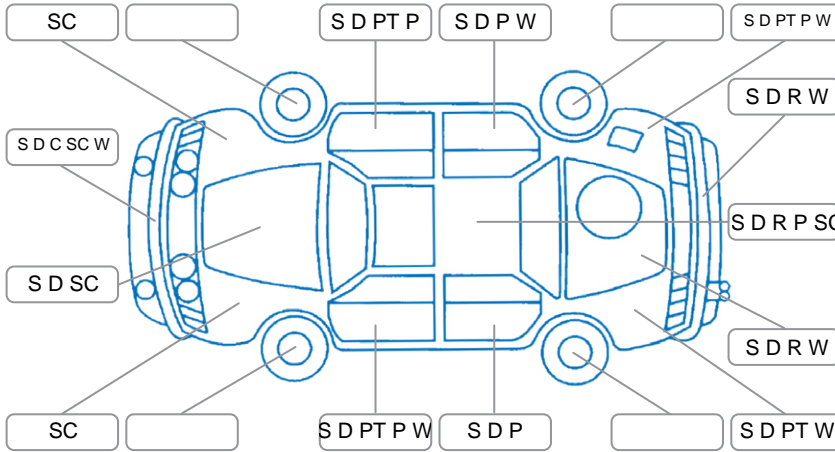

Note: some defects and blemishes may not be displayed in the diagram

**Body Inspection Comments**

Screws holding on left front indicator trim. Left & right front door window frames are crack broken away from doors. Rust around bottom of left front door frame.

Conditions During Body Inspection    Dry

**Under Carriage and Under Bonnet Inspection Comments**

Developing underbody surface rust.

**Interior Comments**

Seats:	Average
Carpets:	Average
Panels:	Average
Dashboard:	Good

**General Comments**

Gearshifts are very stiff & hard to get into gear when changing up into 2nd gear & down shifting into 3rd gear & down shifting into 2nd gear. Rubber floor matting ripped & torn in left & right front. Small burn holes in fabric in base pad on centre seat. Radio is not working.

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Cambelt
Evidence of Cam Belt Replacement	<input checked="" type="checkbox"/> Yes <input type="checkbox"/> No    211,000 Kms

Inspected by:	Jason Young
Published by:	Nick Beaton
Inspection Date:	11 May 2026

	OK	Requires Attention	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation		✓	
Noise	✓		
Clutch	✓		
CV joints			✓
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand brake	✓		
<b>Tyres (lowest observed tread depth of tyres)</b>			
Left front			3.5 mm
Right front			4.0 mm
Left rear			5.0 mm
Right rear			5.0 mm
Spare		Yes	
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation			✓
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL			✓
Window winder RR			✓
Rear view mirrors	✓		
Radio (basic test only)		✓	
CD (basic test only)			✓
Number of keys	2		
Central locking	✓		
Remote locking			✓
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood this condition guide:

NAME \_\_\_\_\_

SIGNATURE \_\_\_\_\_