

Report ID:	28,175,350	Version:	1
Created:	13 May 2026		


Make:	Mazda	Model:	MPV
Body Style:	Wagon	Year:	2005
Rego No.:	HZQ865	Rego Expiry:	24 Aug 2026
WoF Expiry:	25 May 2026	Odometer:	181,893 Kms
Good No.:	28175350	VIN:	7AT0C11EX14439420
Next Service:	178,000kms	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

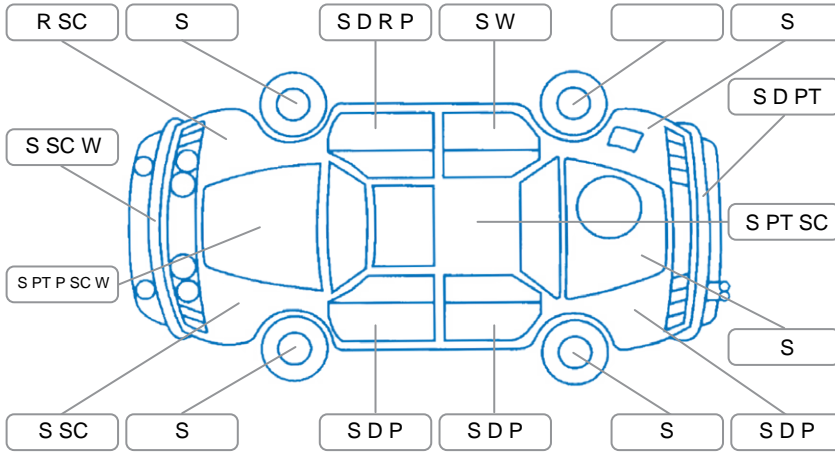

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Right side rear sliding door will not open from switch on dashboard. Right side of rear bumper is not fitting up correctly to rear guard. Cracks in left front headlight lens.

Conditions During Body Inspection	Dry
-----------------------------------	-----

Under Carriage and Under Bonnet Inspection Comments

Oil leak from gearbox. Underbody surface rust, surface rust on radiator support panel.

Interior Comments

Seats:	Good
Carpets:	Good
Panels:	Average
Dashboard:	Good

General Comments

Noisy engine belts & pulley's. Engine a bit smoky on cold start up. Not all display lights are working behind speedo display. Both left & right rear seat head rests are missing.

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Timing Chain
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input type="checkbox"/> No Kms
Inspected by:	Jason Young
Published by:	Nick Beaton
Inspection Date:	11 May 2026

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes		✓	
Engine performance	✓		
Noise		✓	
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			4.0 mm
Right front			4.0 mm
Left rear			6.0 mm
Right rear			2.0 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights		✓	
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood this condition guide:

NAME _____

SIGNATURE _____