

Report ID:	28,182,118	Version:	2
Created:	14 May 2026		


Make:	Mitsubishi	Model:	Triton
Body Style:	Utility	Year:	2022
Rego No.:	PCR425	Rego Expiry:	13 Sep 2026
WoF Expiry:	08 Apr 2027	Odometer:	171,169 Kms
Good No.:	28182118	VIN:	MMAJLKL10NH016674
Next Service:	183,000 Kms	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

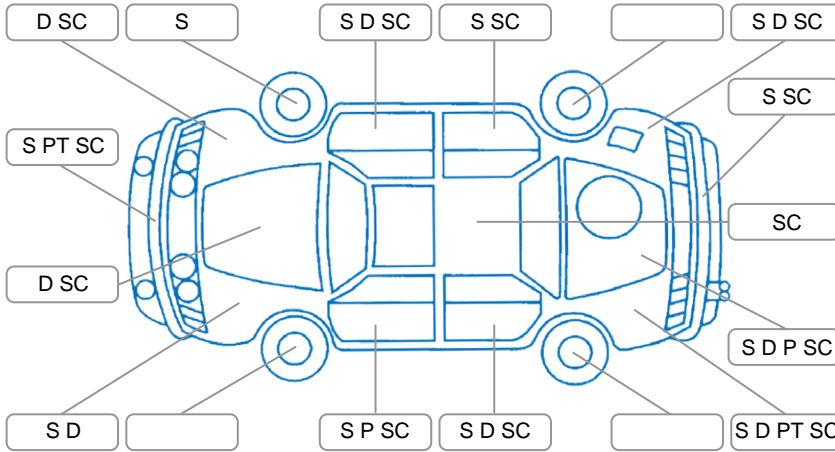

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Front bumper is loose on LH side. RH taillight lens separating, dirt inside.
 All sill step plates worn. One canopy latch not working. LH cab corner dented.
 Both running boards dented and gouged. LH rear moulding missing.
 Stonechip in windscreen. Rear bumper step plate moulding missing.

Conditions During Body Inspection: Dry

Under Carriage and Under Bonnet Inspection Comments

Undercarriage is dirty.

Interior Comments

Seats:	Average. FL seat back pushed in next to airbag.
Carpets:	Average
Panels:	Poor, worn.
Dashboard:	Poor, steering wheel worn.

General Comments

RH side mirror indicator repeater cracked. RF and LR door seals torn.
 Front window washers need adjusted.

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Timing Chain
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input type="checkbox"/> No Kms
Inspected by:	Troy Smith
Published by:	Troy Smith
Inspection Date:	14 May 2026

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			4.5 mm
Right front			5.5 mm
Left rear			3.5 mm
Right rear			3 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera	✓		

I have read and understood this condition guide:

NAME _____

SIGNATURE _____