


Report ID:	28,186,245	Version:	1
Created:	15 May 2026		

Make:	Hyundai	Model:	Iload
Body Style:	Van	Year:	2016
Rego No.:	JZJ99	Rego Expiry:	28 Jan 2027
WoF Expiry:	25 Nov 2026	Odometer:	190,004 Kms
Good No.:	28186245	VIN:	KMFWBX7KMGU837810
Next Service:	191,000 kms	Service History:	No

**Note: This report is not a warranty**  
 This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key**  
 S = Scratch    R = Rust    C = Crack    \* = Decals    W = Significant scuffs  
 D = Dent    PT = Paint defect    P = Pin dent    SC = Stone Chips

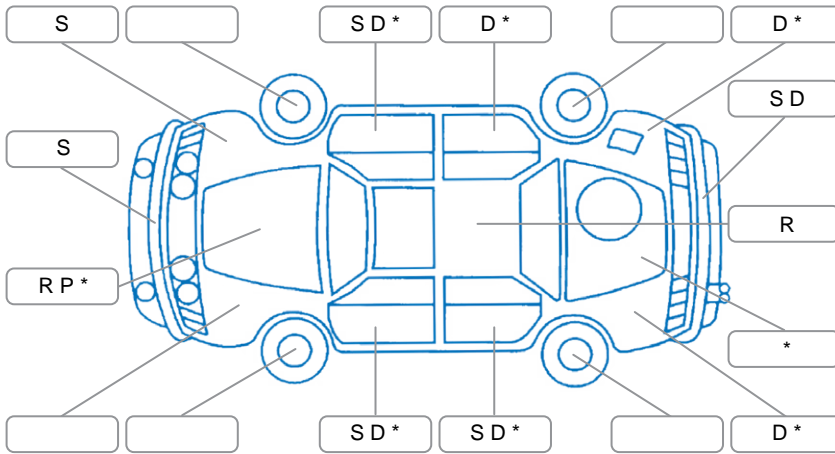

Note: some defects and blemishes may not be displayed in the diagram

### Body Inspection Comments

Rear badge missing, rear wiper blade missing, L interior panel torn, windscreen cracked out cva, missing sun visor driver side. engine oil leak

Conditions During Body Inspection: Wet

### Under Carriage and Under Bonnet Inspection Comments

### Interior Comments

Seats:	Poor
Carpets:	Poor
Panels:	Average
Dashboard:	Average

### General Comments

Both front seat torn, driver seat belt frayed, carpet torn, missing spare tools and jack,

Road Conditions During Test Drive	Wet
Engine Timing Mechanism	Timing Chain
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input type="checkbox"/> No    Kms
Inspected by:	Marlon Espena
Published by:	Marlon Espena
Inspection Date:	15 May 2026

	OK	Requires Attention	N/A
<b>Engine</b>			
Oil level		✓	
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand brake	✓		
<b>Tyres (lowest observed tread depth of tyres)</b>			
Left front			6 mm
Right front			6 mm
Left rear			3 mm
Right rear			3 mm
Spare		Yes	
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL			✓
Window winder RR			✓
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera	✓		

I have read and understood this condition guide:

NAME \_\_\_\_\_

SIGNATURE \_\_\_\_\_