

Report ID:	28,186,640	Version:	1
Created:	19 May 2026		


Make:	Ford	Model:	Escape
Body Style:	Wagon	Year:	2006
Rego No.:	JHG410	Rego Expiry:	16 May 2026
WoF Expiry:	23 Sep 2026	Odometer:	150,575 Kms
Good No.:	28186640	VIN:	LFACZYVX62000254
Next Service:	150,400km's	Service History:	No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

### Key

S = Scratch    R = Rust    C = Crack    \* = Decals    W = Significant scuffs  
 D = Dent    PT = Paint defect    P = Pin dent    SC = Stone Chips

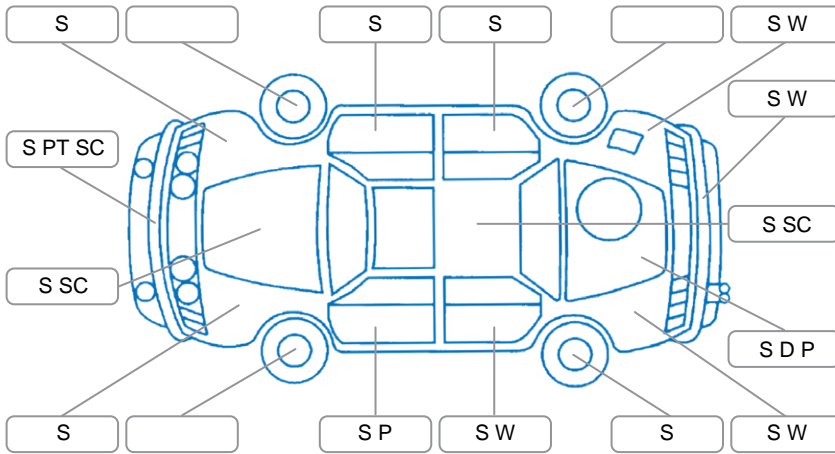

Note: some defects and blemishes may not be displayed in the diagram

### Body Inspection Comments

Reversing camera is not showing a clear picture. Front spotlights are missing out of front bumper. Right rear taillight lens is cracked & broken. Dents in left side running board, has spots of black paint along running board.

Conditions During Body Inspection: Dry

### Under Carriage and Under Bonnet Inspection Comments

Oil leak from engine. Rear differential is starting to leak oil.

### Interior Comments

Seats:	Average
Carpets:	Average
Panels:	Good
Dashboard:	Good

### General Comments

Leather worn on both front seats & back rest of rear seat. Driver's door frame seal is damaged and torn. Touch screen on radio is not working, so can't tune to any radio stations. Engine service is overdue. Left front windscreen washer is not working very well & rear window washer is not working.

Road Conditions During Test Drive	Dry	
Engine Timing Mechanism	Timing Chain	
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input type="checkbox"/> No	Kms
Inspected by:	Jason Young	
Published by:	Tiaan Pienaar	
Inspection Date:	15 May 2026	

	OK	Requires Attention	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand brake	✓		
<b>Tyres (lowest observed tread depth of tyres)</b>			
Left front			5.2 mm
Right front			5.2 mm
Left rear			5.2 mm
Right rear			6.0 mm
Spare		Yes	
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights		✓	
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)		✓	
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera		✓	

I have read and understood this condition guide:

NAME \_\_\_\_\_

SIGNATURE \_\_\_\_\_