

Report ID:	28,193,026	Version:	1
Created:	19 May 2026		


Make:	Suzuki	Model:	Swift
Body Style:	Hatchback	Year:	2010
Rego No.:	LHE320	Rego Expiry:	11 Apr 2027
WoF Expiry:	15 May 2027	Odometer:	121,094 Kms
Good No.:	28193026	VIN:	7AT0GK0CX18104723
Next Service:	126300	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

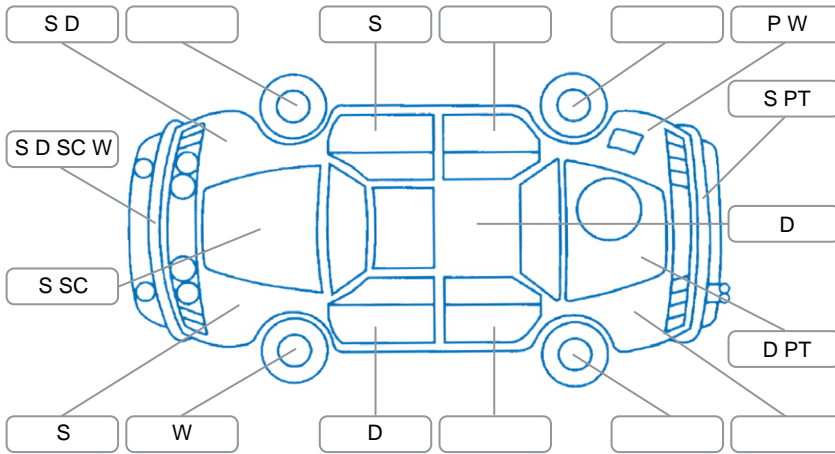

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

CVA stone chip, boot large dent and paint defect, rear bumper not fitting correctly, roof rail cover missing

Conditions During Body Inspection

Dry

Under Carriage and Under Bonnet Inspection Comments

Front cover oil seepage, engine bay surface rust, coolant just under full, front subframe and underbody surface rust, rear sway bar link perished, front left Wheel lining damaged

Interior Comments

Seats:	Average
Carpets:	Average
Panels:	Poor
Dashboard:	Average

General Comments

Interior steering column rattle, Car jerks aggressively on hard acceleration and deceleration, potential transmission issue, engine squeak on cold start and front right suspension noise

Road Conditions During Test Drive	Dry		
Engine Timing Mechanism	Timing Chain		
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes	<input type="checkbox"/> No	Kms
Inspected by:	Byron Dagg		
Published by:	Byron Dagg		
Inspection Date:	19 May 2026		

	OK	Requires Attention	N/A
Engine			
Oil level		✓	
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation		✓	
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			6 mm
Right front			6 mm
Left rear			7 mm
Right rear			7 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood this condition guide:

NAME _____

SIGNATURE _____