

Report ID:	28,195,392	Version:	1
Created:	20 May 2026		


Make:	BMW	Model:	Z3
Body Style:	Convertible	Year:	1998
Rego No.:	RQF118	Rego Expiry:	16 Jan 2027
WoF Expiry:	14 Nov 2026	Odometer:	143,045 Kms
Good No.:	28195392	VIN:	WBACH72090LD10724
Next Service:	158,280kms	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

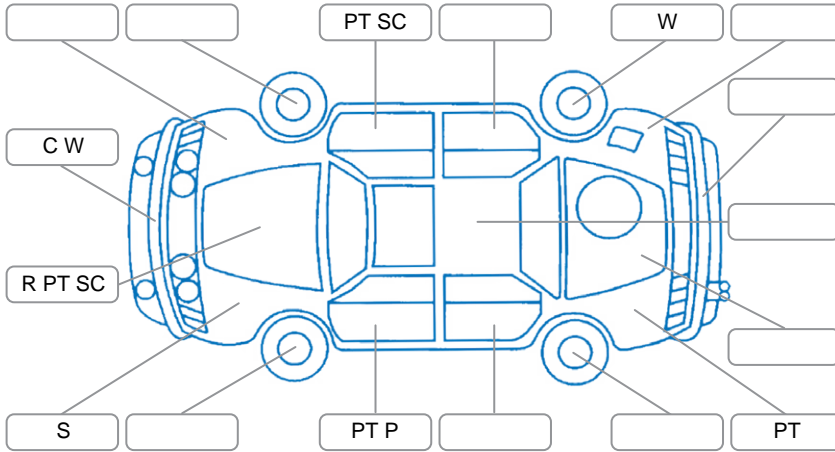

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Paint faded and cracked on bonnet (minor rust is developing). Clear paint is flaking on doors. Minor crack in left tail light.

Conditions During Body Inspection: Dry

Under Carriage and Under Bonnet Inspection Comments

Leaking from engine and transmission, power steering reservoir hose. Weeping from power steering rack.

Interior Comments

Seats:	Average
Carpets:	Good
Panels:	Door speaker grille is cracked.
Dashboard:	Good

General Comments

Power windows are heavy to open(Needs pushing top to start winding down). Remote keys have flat battery. Driver's seat height adjustment is not operating (stacked at high position). Left tail light bulb is not operating. Can not adjust volume of radio.

Road Conditions During Test Drive	Dry	
Engine Timing Mechanism	Timing Chain	
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input type="checkbox"/> No	Kms
Inspected by:	Yuki Itohara	
Published by:	Nick Beaton	
Inspection Date:	20 May 2026	

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			4.0 mm
Right front			4.5 mm
Left rear			4.0 mm
Right rear			4.0 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights		✓	
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL			✓
Window winder RR			✓
Rear view mirrors	✓		
Radio (basic test only)		✓	
CD (basic test only)			✓
Number of keys	3		
Central locking	✓		
Remote locking		✓	
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood this condition guide:

NAME _____

SIGNATURE _____