

Report ID:	28,196,653	Version:	1
Created:	25 May 2026		


Make:	Honda	Model:	FIT
Body Style:	Hatchback	Year:	2003
Rego No.:	FUP315	Rego Expiry:	14 Nov 2026
WoF Expiry:	18 Jun 2026	Odometer:	135,417 Kms
Good No.:	28196653	VIN:	7AT08G2YX11752798
Next Service:	142,000kms	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

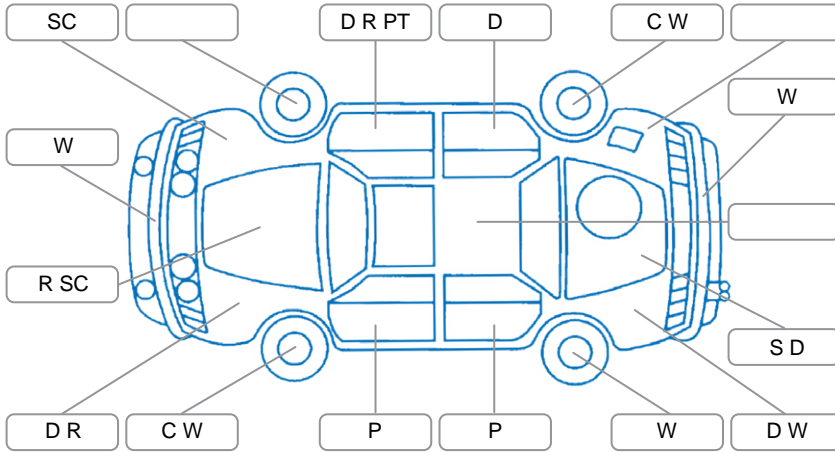

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Paint is cracked in rear bumper. Paint is flaking around dent at bottom of driver's door and surface rust is developing. Minor stone cracks in left side of windshield. Floor panel of cargo (space for spare tyre) is rusty.

Conditions During Body Inspection: Dry

Under Carriage and Under Bonnet Inspection Comments

Minor surface rust is developing under body.

Interior Comments

Seats:	Good
Carpets:	Good
Panels:	Good
Dashboard:	Good

General Comments

Left door mirror electric function is not operating. Can not operate left front window from main switch.

Road Conditions During Test Drive	Dry	
Engine Timing Mechanism	Timing Chain	
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input type="checkbox"/> No	Kms
Inspected by:	Yuki Itohara	
Published by:	Callum Busuttill	
Inspection Date:	25 May 2026	

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			3.0 mm
Right front			3.5 mm
Left rear			5.5 mm
Right rear			3.5 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL		✓	
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood this condition guide:

NAME _____

SIGNATURE _____