


Report ID:	28,201,686	Version:	1
Created:	29 May 2026		

Make:	Hyundai	Model:	Santa FE
Body Style:	SUV	Year:	2009
Rego No.:	FFG422	Rego Expiry:	23 Feb 2027
WoF Expiry:	06 Jun 2026	Odometer:	192,780 Kms
Good No.:	28201686	VIN:	KMHS81XSAU567389
Next Service:	198000	Service History:	No

**Note: This report is not a warranty**  
 This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key**  
 S = Scratch    R = Rust    C = Crack    \* = Decals    W = Significant scuffs  
 D = Dent    PT = Paint defect    P = Pin dent    SC = Stone Chips

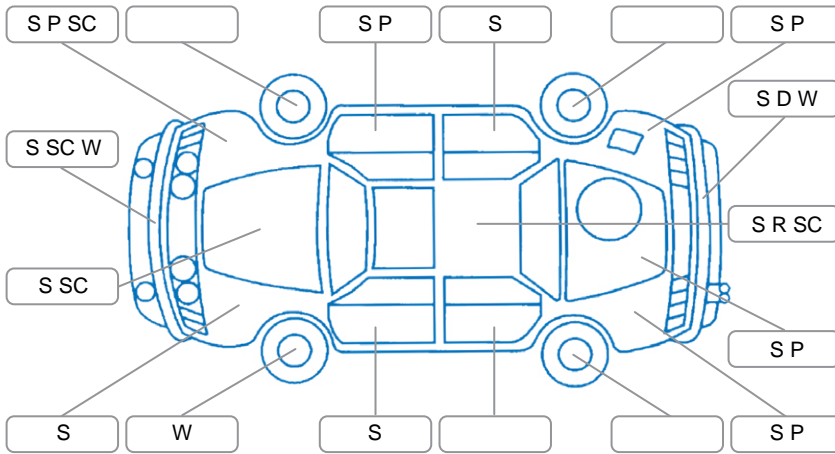

Note: some defects and blemishes may not be displayed in the diagram

### Body Inspection Comments

18 inch wheel on LR and factory wheel in boot, no spare, minor spider rust on roof, windscreen peppered

Conditions During Body Inspection: Dry

### Under Carriage and Under Bonnet Inspection Comments

Rear rotors grooved and pads low, front rotors minor lip, LH inner cv boot split and leaking

### Interior Comments

Seats:	drivers seat worn
Carpets:	Good
Panels:	Good
Dashboard:	Good

### General Comments

Ac not cold, washer jets don't work, rhs low beam not working

Road Conditions During Test Drive	Dry		
Engine Timing Mechanism	Timing Chain		
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes	<input type="checkbox"/> No	Kms
Inspected by:	Darlan Beyer-Way		
Published by:	Vincent Lam		
Inspection Date:	22 May 2026		

	OK	Requires Attention	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand brake	✓		
<b>Tyres (lowest observed tread depth of tyres)</b>			
Left front			8.0 mm
Right front			4.0 mm
Left rear			4.0 mm
Right rear			5.5 mm
Spare		Yes	
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights		✓	
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)		✓	
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors		✓	
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood this condition guide:

NAME \_\_\_\_\_

SIGNATURE \_\_\_\_\_