

Report ID:	28,209,000	Version:	2
Created:	10 Jun 2026		


Make:	Volkswagen	Model:	Crafter
Body Style:	Van	Year:	2021
Rego No.:	NFQ409	Rego Expiry:	13 Jan 2027
WoF Expiry:	03 Feb 2027	Odometer:	114,868 Kms
Good No.:	28209000	VIN:	WV1ZZSYZM9010729
Next Service:	120,000 kms	Service History:	Yes

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key**

S = Scratch    R = Rust    C = Crack    \* = Decals    W = Significant scuffs  
 D = Dent    PT = Paint defect    P = Pin dent    SC = Stone Chips

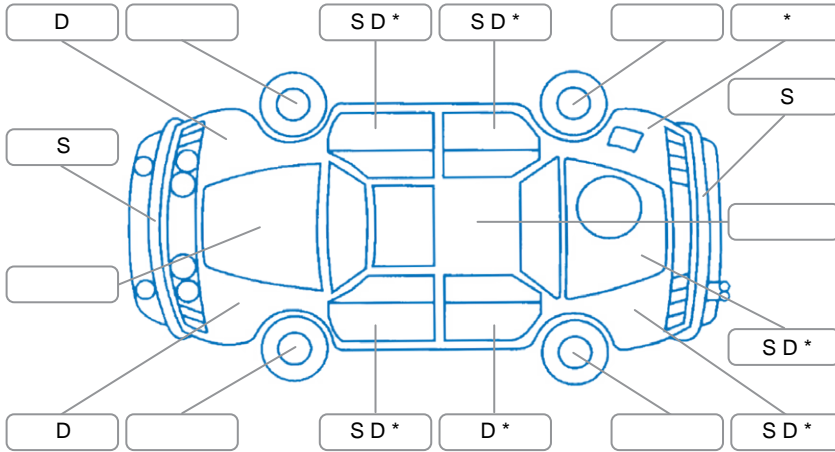

Note: some defects and blemishes may not be displayed in the diagram

**Body Inspection Comments**

Rear tail badge missing, L front outer cv boot split, oil service due, front bumper left moulding needs refit, Left Front Tyre outer edge wear, Left Rear Tyre outer edge wear, right tail light scuffs, B pillar dents, right side sill dent

Conditions During Body Inspection: Wet

**Under Carriage and Under Bonnet Inspection Comments**

**Interior Comments**

Seats:	Average
Carpets:	Average
Panels:	Average
Dashboard:	Good

**General Comments**

Driver seat cover and handle adjustable missing, windscreen cracked out cva,

Road Conditions During Test Drive	Wet
Engine Timing Mechanism	Cambelt
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input checked="" type="checkbox"/> No    Kms
Inspected by:	Marlon Espena
Published by:	Darryl Kereti
Inspection Date:	09 Jun 2026

	OK	Requires Attention	N/A
<b>Engine</b>			
Oil level		✓	
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand brake	✓		
<b>Tyres (lowest observed tread depth of tyres)</b>			
Left front			5.0 mm
Right front			5.0 mm
Left rear			5.0 mm
Right rear			5.0 mm
Spare		Yes	
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL			✓
Window winder RR			✓
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera	✓		

I have read and understood this condition guide:

NAME \_\_\_\_\_

SIGNATURE \_\_\_\_\_