

Report ID:	28,215,211	Version:	1
Created:	12 Jun 2026		


Make:	Land Rover	Model:	Defender
Body Style:	Wagon	Year:	1995
Rego No.:	ESS152	Rego Expiry:	05 May 2027
WoF Expiry:	05 Jul 2026	Odometer:	380,500 Kms
Good No.:	28215211	VIN:	SALLDHMF7MA961952
Next Service:	314,300km's	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

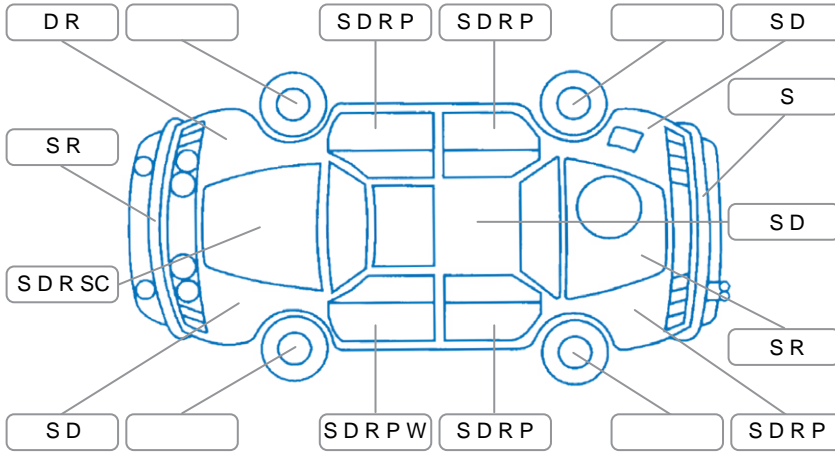

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Rust at bottom of right front A pillar.

Conditions During Body Inspection Dry

Under Carriage and Under Bonnet Inspection Comments

Oil leaks from engine & 4WD transfer box. Left front hub seal is leaking. Radiator/coolant system needs a flush.

Interior Comments

Seats:	Good
Carpets:	Good
Panels:	Average
Dashboard:	Average

General Comments

Correct km's are 314,325km's. Driver's & left front seat belts have webbing worn & damaged, both belts need replacing. Radio not working. Heater fan not working. Holes in dashboard. Speedo display surround is not mounted in place.

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Timing Chain
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input type="checkbox"/> No Kms

Inspected by:	Jason Young
Published by:	Melissa Wilson
Inspection Date:	11 Jun 2026

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition		✓	
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch	✓		
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			8.0 mm
Right front			8.0 mm
Left rear			8.0 mm
Right rear			8.0 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation			✓
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)		✓	
CD (basic test only)		✓	
Number of keys	1		
Central locking			✓
Remote locking			✓
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood this condition guide:

NAME _____

SIGNATURE _____