

Report ID:	28,222,199	Version:	1
Created:	05 Jun 2026		


Make:	Hyundai	Model:	Santa FE
Body Style:	SUV	Year:	2008
Rego No.:	ESG740	Rego Expiry:	28 Jul 2026
WoF Expiry:	03 Jul 2026	Odometer:	241,142 Kms
Good No.:	28222199	VIN:	KMHS81DR8U284754
Next Service:	236000	Service History:	Yes

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

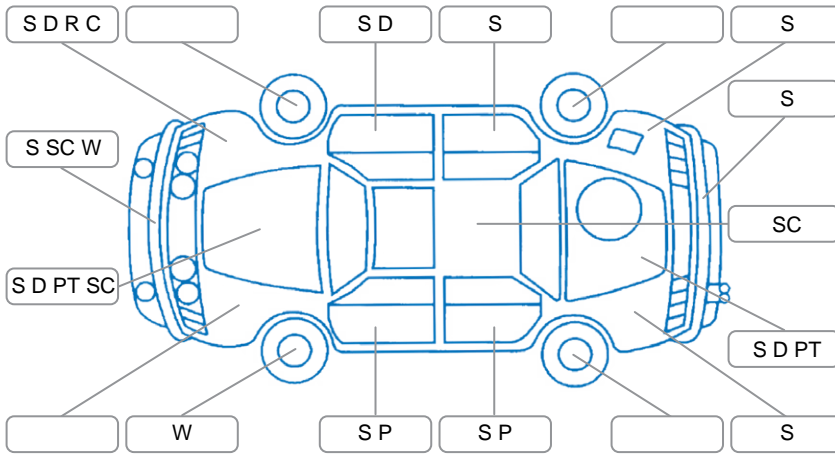

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Bonnet and front bumper (misaligned) different colour to car, rear tailgate tint failing, windscreen pitting

Conditions During Body Inspection	Wet
-----------------------------------	-----

Under Carriage and Under Bonnet Inspection Comments

Coolant overflow bottle empty, rear pads low, all rotors lipped, FR tie rod engine split, major engine oil leaks

Interior Comments

Seats:	drivers seat bolster torn, leather shrunk on front
Carpets:	Average
Panels:	panels stick, rhs front torn
Dashboard:	Good

General Comments

Drivers park light not working, belt noise, front suspension knock, steering heavily pulls left

Road Conditions During Test Drive	Wet
Engine Timing Mechanism	Cambelt
Evidence of Cam Belt Replacement	<input checked="" type="checkbox"/> Yes <input type="checkbox"/> No 200,916 Kms
Inspected by:	Darian Beyer-Way
Published by:	Vincent Lam
Inspection Date:	02 Jun 2026

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise		✓	
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance		✓	
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			5.0 mm
Right front			5.0 mm
Left rear			5.5 mm
Right rear			6.0 mm
Spare		Yes	
Suspension			
Suspension performance		✓	
Steering performance		✓	
Shock absorbers	✓		
Air Conditioning / Heater			
Operation		✓	
Electrical / Accessories			
Head lights		✓	
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood this condition guide:

NAME _____

SIGNATURE _____