

Report ID:	28,222,446	Version:	3
Created:	29 Jun 2026		


Make:	Hyundai	Model:	Santa FE
Body Style:	SUV	Year:	2014
Rego No.:	HJW319	Rego Expiry:	29 Dec 2026
WoF Expiry:	03 Jun 2027	Odometer:	237,925 Kms
Good No.:	28222446	VIN:	KMHST81XSEU308242
Next Service:	241,042km's	Service History:	No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

### Key

S = Scratch    R = Rust    C = Crack    \* = Decals    W = Significant scuffs  
 D = Dent    PT = Paint defect    P = Pin dent    SC = Stone Chips

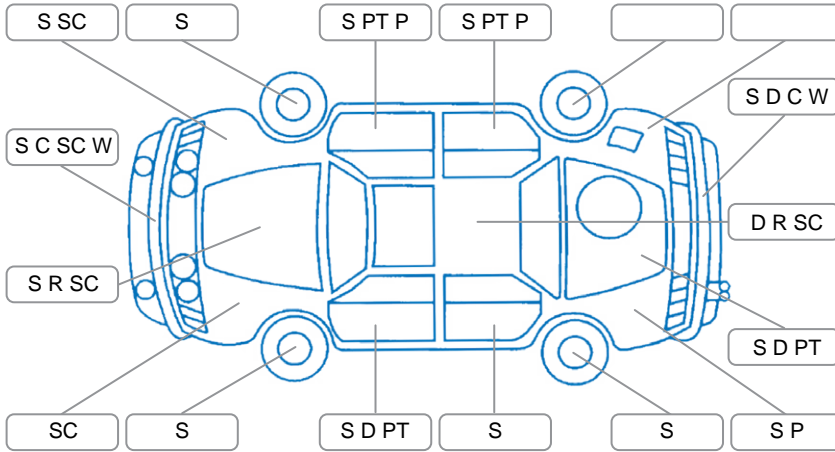

Note: some defects and blemishes may not be displayed in the diagram

### Body Inspection Comments

- Plastic cover missing off interior panel on tailgate.
- Unable to reset service KMs
- Right Side lower steering wheel buttons not working

Conditions During Body Inspection: Dry

### Under Carriage and Under Bonnet Inspection Comments

### Interior Comments

Seats:	Good
Carpets:	Good
Panels:	Average
Dashboard:	Average

### General Comments

. Dash air vents adjustment direction tabs broken off & missing air vent fins. Plastic trim broken off three electric window switches on master switch on driver's door & also switch on left rear door. No keys for locks on roof rack.

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Timing Chain
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input type="checkbox"/> No    Kms

Inspected by:	Kris Milne
Published by:	Kris Milne
Inspection Date:	29 Jun 2026

	OK	Requires Attention	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand brake	✓		
<b>Tyres (lowest observed tread depth of tyres)</b>			
Left front			7 mm
Right front			7 mm
Left rear			8 mm
Right rear			2.7 mm
Spare		Yes	
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys		2	
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)		✓	
Reversing camera	✓		

I have read and understood this condition guide:

NAME \_\_\_\_\_

SIGNATURE \_\_\_\_\_