

Report ID:	28,224,084	Version:	1
Created:	03 Jun 2026		


Make:	Mazda	Model:	Axela
Body Style:	Hatchback	Year:	2005
Rego No.:	HSW759	Rego Expiry:	15 Jul 2026
WoF Expiry:	25 Jul 2026	Odometer:	208,699 Kms
Good No.:	28224084	VIN:	7AT0C13JX14213695
Next Service:	203,591 Kms	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

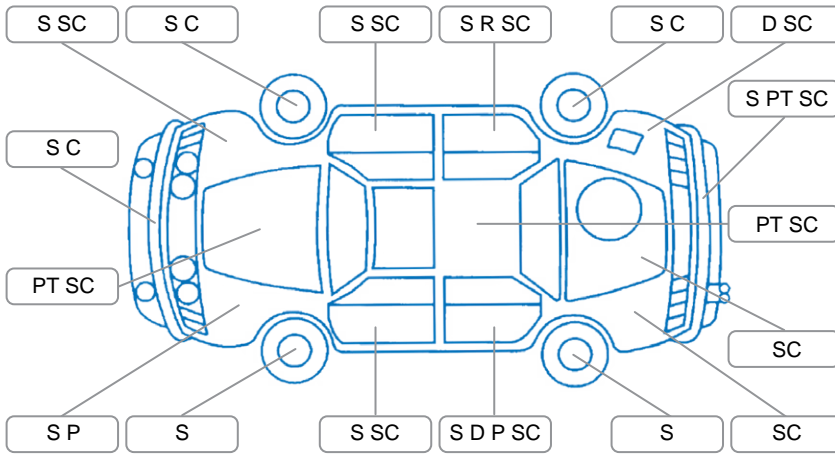

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Hairline cracks in both headlights. Rust in RR door frame.
 Front bumper lower LH moulding loose. Surface rust in spare wheel well.
 RF door seal loose. 2 roof gutter moulding caps missing.
 RF door jam/B pillar dented and scratched. Aerial stalk damaged.

Conditions During Body Inspection

Under Carriage and Under Bonnet Inspection Comments

Engine oil leaks.
 LF shock absorber leaking.

Interior Comments

Seats:	Poor, drivers seat back torn.
Carpets:	Poor, hole worn in drivers floor.
Panels:	Average
Dashboard:	Average

General Comments

Key blade is loose in key remote. RH park light not working.
 Check engine light on. High stop light not working.
 Engine vibration in cabin. Both front tyres low on tread.
 Front wiper blades need replaced. Rear suspension knock.

Road Conditions During Test Drive	Dry		
Engine Timing Mechanism	Timing Chain		
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes	<input type="checkbox"/> No	Kms
Inspected by:	Troy Smith		
Published by:	Troy Smith		
Inspection Date:	03 Jun 2026		

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			1.5 mm
Right front			1.5 mm
Left rear			6.5 mm
Right rear			4 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers		✓	
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights		✓	
Tail lights		✓	
Indicators	✓		
Dashboard warning lights		✓	
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood this condition guide:

NAME _____

SIGNATURE _____