


Report ID:	28,224,176	Version:	2
Created:	05 Jun 2026		

Make:	Mitsubishi	Model:	Pajero
Body Style:	SUV	Year:	2000
Rego No.:	ESF268	Rego Expiry:	10 Oct 2026
WoF Expiry:	21 Oct 2026	Odometer:	286,669 Kms
Good No.:	28224176	VIN:	7A8CJ080708209150
Next Service:	Unknown	Service History:	No

Note: This report is not a warranty
 This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key
 S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

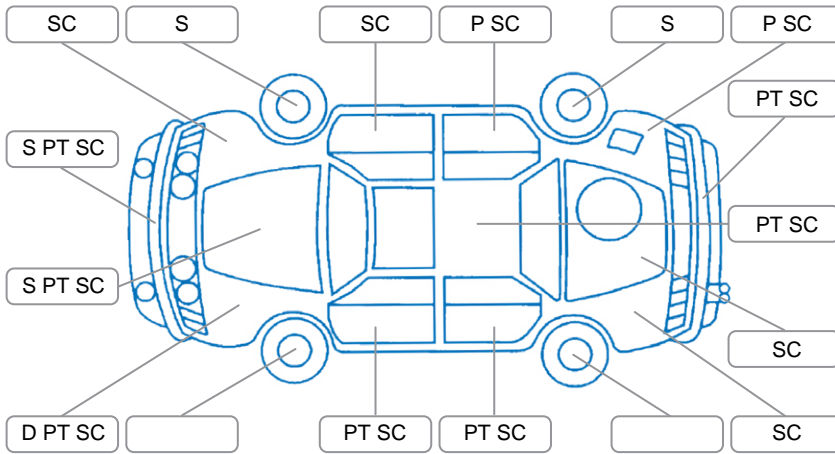

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

- Paint defect on LH cant rail.
- Stone chip in windscreen.
- Rear tow hook cover missing.
- Tailgate shut starting to rust.

Conditions During Body Inspection: Dry

Under Carriage and Under Bonnet Inspection Comments

- Minor engine oil leak
- Engine skid plate bent.

Interior Comments

Seats:	Average
Carpets:	Good
Panels:	Average
Dashboard:	Average

General Comments

- Only water in coolant system. LH indicator faulty. RH taillight fail. Pulls to the right.
- No retraction in mirrors.
- Heater fan fail.

Road Conditions During Test Drive	Dry	
Engine Timing Mechanism	Cambelt	
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes	<input checked="" type="checkbox"/> No
Inspected by:	Caleb Spicer Lee	
Published by:	Pieter Van Vliet	
Inspection Date:	03 Jun 2026	

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition		✓	
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			4.0 mm
Right front			6.0 mm
Left rear			4.5 mm
Right rear			4.5 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation		✓	
Electrical / Accessories			
Head lights	✓		
Tail lights		✓	
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors		✓	
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking			✓
Remote locking			✓
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood this condition guide:

NAME _____

SIGNATURE _____