


Report ID:	28,231,096	Version:	1
Created:	12 Jun 2026		

Make:	Ford	Model:	Mondeo
Body Style:	Wagon	Year:	1998
Rego No.:	ADC753	Rego Expiry:	19 Sep 2026
WoF Expiry:	13 Jul 2026	Odometer:	295,497 Kms
Good No.:	28231096	VIN:	WFONXXGBBNVE83794
Next Service:	297,933km's	Service History:	No

**Note: This report is not a warranty**  
 This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key**  
 S = Scratch    R = Rust    C = Crack    \* = Decals    W = Significant scuffs  
 D = Dent    PT = Paint defect    P = Pin dent    SC = Stone Chips

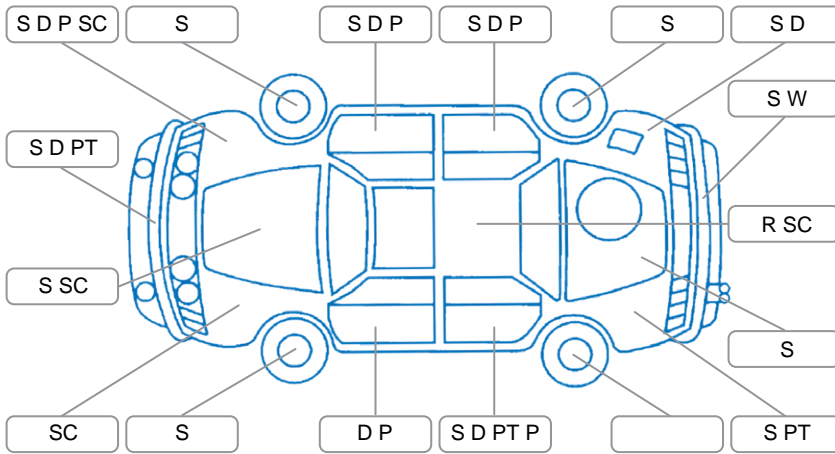

Note: some defects and blemishes may not be displayed in the diagram

### Body Inspection Comments

Paint clear coat peeling off front bumper. Right corner of front bumper is not fitting properly. Hole in right side of front bumper. Both rear tyres & right front tyre will need replacing soon, tread depth is very low. Dent & scratches in left front sill.

Conditions During Body Inspection: Dry

### Under Carriage and Under Bonnet Inspection Comments

Oil leak from engine. Leaking power steering fluid.

### Interior Comments

Seats:	Good
Carpets:	Good
Panels:	Average
Dashboard:	Good

### General Comments

Wing mirror adjustment switch is not working. A/C is not getting cold. Rear window washer on tailgate is not working. Catch broken on lid of centre console.

Road Conditions During Test Drive	Dry	
Engine Timing Mechanism	Cambelt	
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes	<input checked="" type="checkbox"/> No
Inspected by:	Jason Young	
Published by:	Sara Haggerty	
Inspection Date:	11 Jun 2026	

	OK	Requires Attention	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch	✓		
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand brake	✓		
<b>Tyres (lowest observed tread depth of tyres)</b>			
Left front			2.7 mm
Right front			1.7 mm
Left rear			1.6 mm
Right rear			1.6 mm
Spare		Yes	
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation		✓	
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	2		
Central locking	✓		
Remote locking		✓	
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood this condition guide:

NAME \_\_\_\_\_

SIGNATURE \_\_\_\_\_