

Report ID:	28,236,866	Version:	1
Created:	11 Jun 2026		


Make:	Mitsubishi	Model:	Delica
Body Style:	SUV	Year:	2003
Rego No.:	JFL974	Rego Expiry:	11 Jul 2026
WoF Expiry:	11 Sep 2026	Odometer:	243,271 Kms
Good No.:	28236866	VIN:	7AT0CJ0PX11900446
Next Service:	249,000km's	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

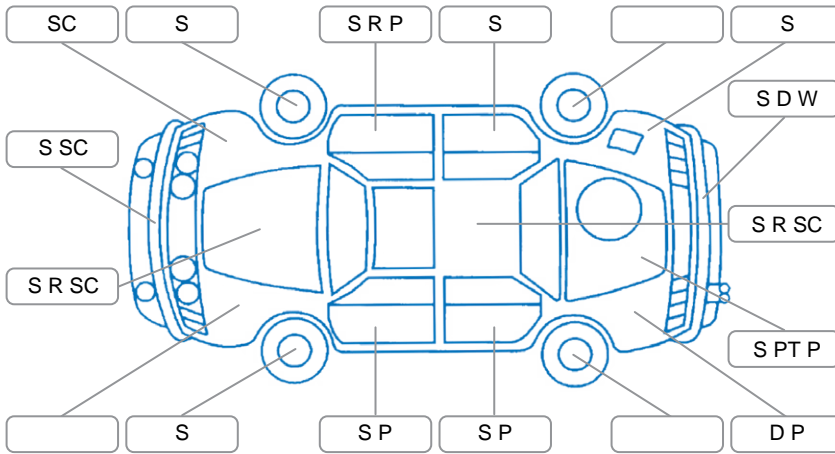

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Surface rust in engine bay, around top radiator support panel. Crack in left front indicator lens.

Conditions During Body Inspection

Dry

Under Carriage and Under Bonnet Inspection Comments

Radiator/coolant system needs a flush with new coolant. Oil leaks from engine. Underbody surface rust.

Interior Comments

Seats:	Average
Carpets:	Good
Panels:	Good
Dashboard:	Good

General Comments

Engine a bit noisy on cold start up. Both rear seat head rests are missing. Not all display light are showing up on dash display when in 4WD. Left side sliding door is not unlocking with central locking. Hole in fabric on base pad of driver's seat, also has some foam missing.

Road Conditions During Test Drive	Dry	
Engine Timing Mechanism	Cambelt	
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes	<input checked="" type="checkbox"/> No
Inspected by:	Jason Young	
Published by:	Callum Busuttill	
Inspection Date:	08 Jun 2026	

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise		✓	
Coolant condition		✓	
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			5.0 mm
Right front			6.0 mm
Left rear			6.0 mm
Right rear			6.0 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL			✓
Window winder RR			✓
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	2		
Central locking		✓	
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood this condition guide:

NAME _____

SIGNATURE _____