

Report ID:	28,250,684	Version:	2
Created:	17 Jun 2026		


Make:	Subaru	Model:	Legacy
Body Style:	Wagon	Year:	1996
Rego No.:	UC5668	Rego Expiry:	01 Jul 2026
WoF Expiry:	20 Oct 2026	Odometer:	238,866 Kms
Good No.:	28250684	VIN:	JF1BG7KJ4TG021817
Next Service:	244,100 Kms	Service History:	Yes

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key**

S = Scratch    R = Rust    C = Crack    \* = Decals    W = Significant scuffs  
 D = Dent    PT = Paint defect    P = Pin dent    SC = Stone Chips

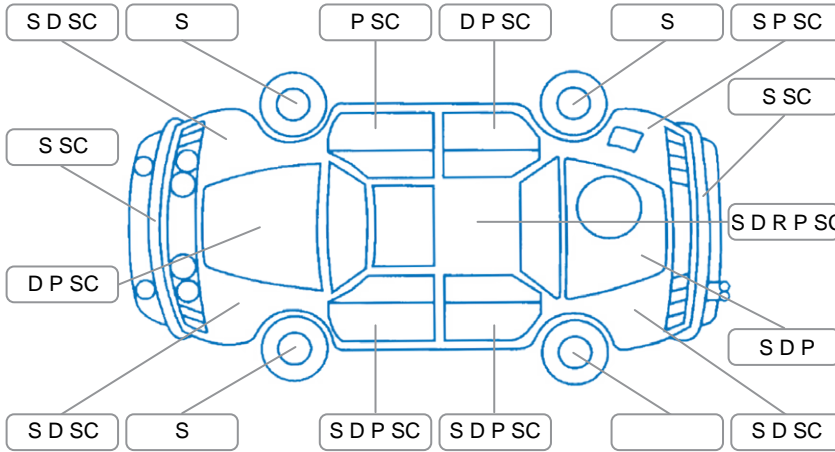

Note: some defects and blemishes may not be displayed in the diagram

**Body Inspection Comments**

RH side window monsoon missing.      RH side mirror base taped up.  
 Hail damage on roof and bonnet.  
 Spider rust and rust bubbling on roof along on edge of windscreen.  
 Rear tyres getting low on tread.

Conditions During Body Inspection

**Under Carriage and Under Bonnet Inspection Comments**

Major engine oil leaks.  
 RH outer CV boot split.  
 Minor gearbox oil leak.

**Interior Comments**

Seats:	Good
Carpets:	Good
Panels:	Average, steering column surround damaged.
Dashboard:	Good

**General Comments**

Evidence of cambelt replacement on invoice dated 10/03/16, 176,773 Kms.  
 Service history up until 192,019 Kms.      AC not cold.  
 Seperate keys for doors and ignition.  
 Reverse lights and front fog lights not working.

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Cambelt
Evidence of Cam Belt Replacement	<input checked="" type="checkbox"/> Yes <input type="checkbox"/> No      176,773 Kms
Inspected by:	Troy Smith
Published by:	Shanna Bullion
Inspection Date:	14 Jun 2026

	OK	Requires Attention	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch	✓		
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand brake	✓		
<b>Tyres (lowest observed tread depth of tyres)</b>			
Left front			5.0 mm
Right front			5.5 mm
Left rear			2.0 mm
Right rear			2.0 mm
Spare		Yes	
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation		✓	
<b>Electrical / Accessories</b>			
Head lights		✓	
Tail lights		✓	
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	2		
Central locking	✓		
Remote locking			✓
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood this condition guide:

NAME \_\_\_\_\_

SIGNATURE \_\_\_\_\_