


Report ID:	28,261,474	Version:	1
Created:	25 Jun 2026		

Make:	Volkswagen	Model:	Tiguan
Body Style:	SUV	Year:	2016
Rego No.:	JMF204	Rego Expiry:	15 Oct 2026
WoF Expiry:	10 Dec 2026	Odometer:	129,698 Kms
Good No.:	28261474	VIN:	WVGZZZ5NZFW085751
Next Service:	130,861kms	Service History:	No

Note: This report is not a warranty
 This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key
 S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

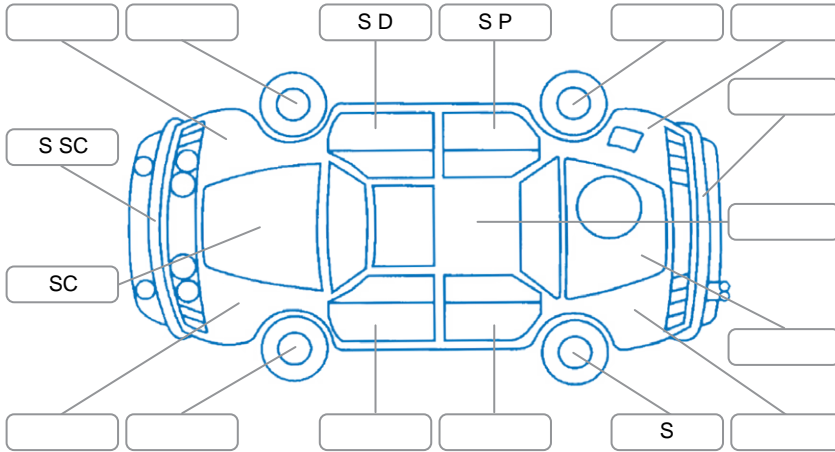

Note: some defects and blemishes may not be displayed in the diagram

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			6.0 mm
Right front			6.0 mm
Left rear			2.5 mm
Right rear			3.0 mm
Spare		Yes	
Suspension			
Suspension performance		✓	
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys		2	
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)	✓		
Reversing camera	✓		

Body Inspection Comments

Conditions During Body Inspection: Dry

Under Carriage and Under Bonnet Inspection Comments

Coolant is leaking from around lower hose sensor. Oil weeping from around inter cooler piping. Weeping from around engine and transmission. Bushes of front suspension are torn.

Interior Comments

Seats:	Good
Carpets:	Good
Panels:	Good
Dashboard:	Good

General Comments

Rear passenger air vent is broken. Response of ignition button is not good. Rear window washer is not operating.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain

Evidence of Cam Belt Replacement: Yes No Kms

Inspected by:	Yuki Itohara
Published by:	Callum Busuttill
Inspection Date:	22 Jun 2026

I have read and understood this condition guide: NAME _____

SIGNATURE _____