

Report ID:	28,263,428	Version:	1
Created:	18 Jun 2026		


Make:	Holden	Model:	Colorado
Body Style:	Utility	Year:	2010
Rego No.:	FHE16	Rego Expiry:	23 Apr 2026
WoF Expiry:	23 Jul 2026	Odometer:	240,598 Kms
Good No.:	28263428	VIN:	MMMTFS85JAH518253
Next Service:	246300 Kms	Service History:	No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key**

S = Scratch    R = Rust    C = Crack    \* = Decals    W = Significant scuffs  
 D = Dent    PT = Paint defect    P = Pin dent    SC = Stone Chips

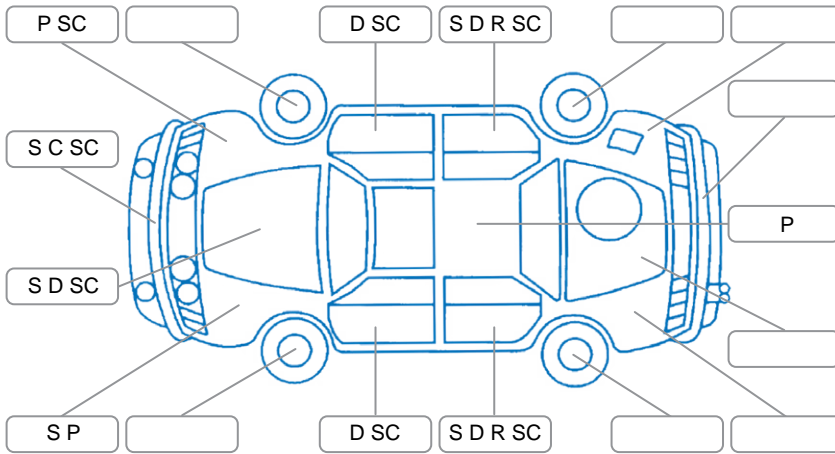

Note: some defects and blemishes may not be displayed in the diagram

**Body Inspection Comments**

Two cracks in windscreen CVA.  
 Rear right reverse and indicator lamp cracked.

Conditions During Body Inspection    Dry

**Under Carriage and Under Bonnet Inspection Comments**

Underbody surface rust.  
 Minor oil weep from rear differential.

**Interior Comments**

Seats:	Average
Carpets:	Average
Panels:	Average
Dashboard:	Average

**General Comments**

4WD.  
 A/C not pushing cold air.  
 Left electric mirror has limited movement and right mirror won't adjust at all.

Road Conditions During Test Drive	Dry		
Engine Timing Mechanism	Timing Chain		
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes	<input type="checkbox"/> No	Kms
Inspected by:	Flynn Burdon		
Published by:	Kieran Driver		
Inspection Date:	18 Jun 2026		

	OK	Requires Attention	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand brake	✓		
<b>Tyres (lowest observed tread depth of tyres)</b>			
Left front			3.2 mm
Right front			3.2 mm
Left rear			4.3 mm
Right rear			3.7 mm
Spare		Yes	
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation		✓	
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL			✓
Window winder RR			✓
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	1		
Central locking	✓		
Remote locking			✓
Sat. nav. (basic test only)			✓
Reversing camera	✓		

I have read and understood this condition guide:

NAME \_\_\_\_\_

SIGNATURE \_\_\_\_\_