

Report ID:	28,267,824	Version:	2
Created:	02 Jul 2026		


Make:	Mazda	Model:	Bt-50
Body Style:	Utility	Year:	2009
Rego No.:	FBA183	Rego Expiry:	01 Sep 2026
WoF Expiry:	09 Sep 2026	Odometer:	432,643 Kms
Good No.:	28267824	VIN:	MM0UNY0E400832936
Next Service:	384,041kms	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

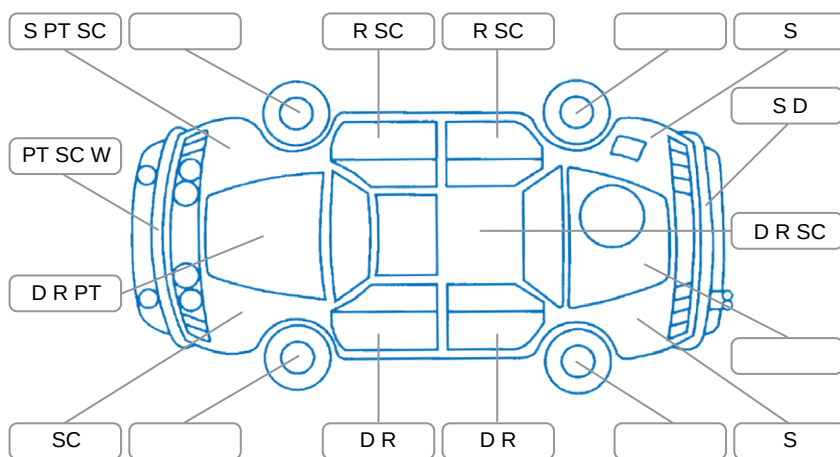

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Bonnet moulding is missing. Paint is flaking and developing surface rust on bonnet (Under bonnet is rusty) . Radiator support is rusty. Spare tyre and tools are missing. Left running board has bent and missing rear end covers. Clear paint is flaking on right rear door.

Conditions During Body Inspection Dry

Under Carriage and Under Bonnet Inspection Comments

Weeping from around engine and transmission.

Interior Comments

Seats:	Driver's seat is worn, torn.
Carpets:	Right front is torn.
Panels:	Cloth is sagging.
Dashboard:	Average

General Comments

Current RUC and Registration are not displayed. Service is well overdue. Electric mirrors are not operating. AC mode selector is faulty, cannot choose face only. Remote key battery is flat. Driver's seat belt is not rewinding smoothly. Coolant level was low. Monitoring required.

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Cambelt
Evidence of Cam Belt Replacement	☐ Yes ☒ No Kms
Inspected by:	Yuki Itohara
Published by:	Nick Beaton
Inspection Date:	22 Jun 2026

OK Requires Attention N/A

Engine

Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		

Transmission

Operation	✓		
Noise	✓		
Clutch	✓		
CV joints	✓		
Wheel bearings	✓		

Brakes

Performance	✓		
Hand brake	✓		

Tyres (lowest observed tread depth of tyres)

Left front	5.0 mm
Right front	6.0 mm
Left rear	9.0 mm
Right rear	4.0 mm
Spare	No

Suspension

Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		

Air Conditioning / Heater

Operation		✓	
-----------	--	---	--

Electrical / Accessories

Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking		✓	
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood this condition guide:

NAME _____

SIGNATURE _____