

Report ID:	28,269,515	Version:	1
Created:	23 Jun 2026		


Make:	Hyundai	Model:	Iload
Body Style:	Van	Year:	2021
Rego No.:	NLD225	Rego Expiry:	20 Jul 2026
WoF Expiry:	24 Jun 2026	Odometer:	148,309 Kms
Good No.:	28269515	VIN:	KMFWBX7KMMU184371
Next Service:	154,000 Kms	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

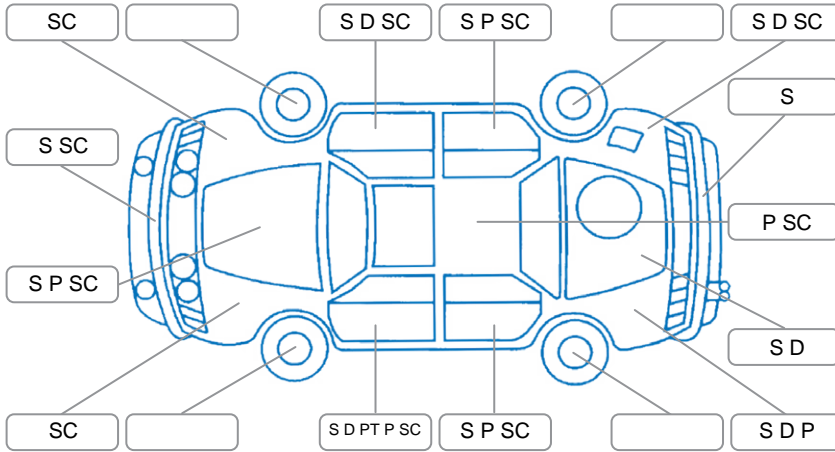

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

- Both sills dented and scuffed.
- RH taillight cracked.
- Tailgate window tints scratched.
- LF tyre wearing on outside shoulder.

Conditions During Body Inspection	Dry
-----------------------------------	-----

Under Carriage and Under Bonnet Inspection Comments

Minor engine oil leak.

Interior Comments

Seats:	Poor, drivers seat base torn.
Carpets:	Average, drivers footrest torn.
Panels:	Average
Dashboard:	Average, steering wheel worn.

General Comments

- Fraying on drivers seatbelt.
- Noise in pulley.
- Front window washers not working. Rear window washer leaks inside tailgate.
- RH brake light not working.

Road Conditions During Test Drive	Dry
-----------------------------------	-----

Engine Timing Mechanism	Timing Chain
-------------------------	--------------

Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input type="checkbox"/> No	Kms
----------------------------------	--	-----

Inspected by:	Troy Smith
---------------	------------

Published by:	Troy Smith
---------------	------------

Inspection Date:	23 Jun 2026
------------------	-------------

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			6 mm
Right front			6 mm
Left rear			5 mm
Right rear			5.5 mm
Spare		N/A	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights		✓	
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)		✓	
Window winder FL	✓		
Window winder FR	✓		
Window winder RL			✓
Window winder RR			✓
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera	✓		

I have read and understood this condition guide:

NAME _____

SIGNATURE _____