

Report ID:	28,270,471	Version:	2
Created:	25 Jun 2026		


Make:	Mitsubishi	Model:	Triton
Body Style:	Utility	Year:	2017
Rego No.:	KYM58	Rego Expiry:	24 Jul 2026
WoF Expiry:	04 Oct 2026	Odometer:	77,393 Kms
Good No.:	28270471	VIN:	MMAYYKK10HH017611
Next Service:	90,000 Kms	Service History:	Yes

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

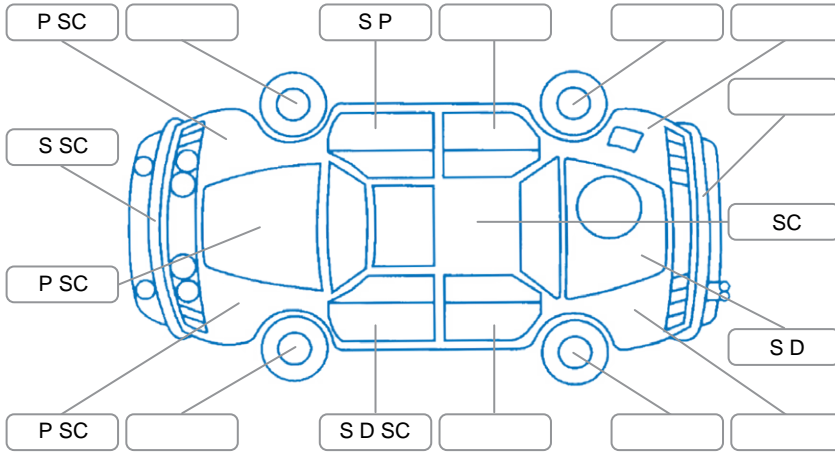

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Both headlights are delaminating. LH can corner dented and scratched.
 Both sill step plates worn.
 Minor dent in RH sill.
 Trailer plug mount dented, plug loose.

Conditions During Body Inspection

Under Carriage and Under Bonnet Inspection Comments

Interior Comments

Seats: Average, passenger seat base torn.
 Carpets: Average, missing floor mats.
 Panels: Average
 Dashboard: Average, steering wheel worn.

General Comments

Hand brake alarm fitted, horn will operate continuously if hand brake is released when drivers door is opened.
 Front window wiper blades need replaced.

Road Conditions During Test Drive	Dry		
Engine Timing Mechanism	Timing Chain		
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes	<input type="checkbox"/> No	Kms
Inspected by:	Troy Smith		
Published by:	Kate Gibson		
Inspection Date:	23 Jun 2026		

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			6.5 mm
Right front			6.5 mm
Left rear			7.0 mm
Right rear			6.5 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL			✓
Window winder RR			✓
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood this condition guide:

NAME _____

SIGNATURE _____