

Report ID:	28,290,364	Version:	1
Created:	30 Jun 2026		


Make:	Hyundai	Model:	Iload
Body Style:	Van	Year:	2013
Rego No.:	HEM896	Rego Expiry:	31 Aug 2026
WoF Expiry:	28 May 2027	Odometer:	307,459 Kms
Good No.:	28290364	VIN:	KMFWBX7KMDU602654
Next Service:	309,000 Kms	Service History:	Yes

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

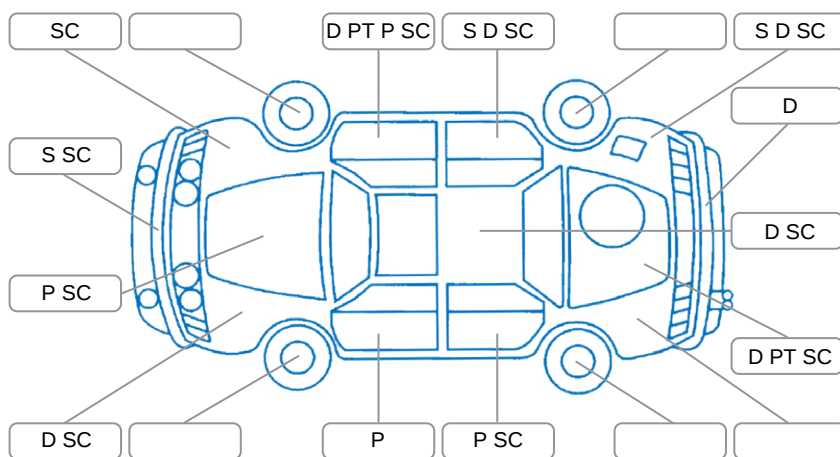

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

RF sill step plate worn.
Stonechip/crack in windscreen.
LH side mirror scuffed.
LH inner wheel arch dented.

Conditions During Body Inspection Dry

Under Carriage and Under Bonnet Inspection Comments

Minor engine oil leak.

Interior Comments

Seats: Good
Carpets: Poor, torn in drivers footwell.
Panels: Average, cargo area panels damaged.
Dashboard: Average, steering wheel worn.

General Comments

Engine rattle on engine startup. Engine is also noisy once warmed up.
Front window washers need adjusted.
Drivers seatbelt fraying.
One key remote only works intermittently.

Road Conditions During Test Drive	Dry		
Engine Timing Mechanism	Timing Chain		
Evidence of Cam Belt Replacement	☐ Yes	☐ No	Kms
Inspected by:	Troy Smith		
Published by:	Troy Smith		
Inspection Date:	30 Jun 2026		

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise		✓	
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			5.5 mm
Right front			4 mm
Left rear			4.5 mm
Right rear			3 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL			✓
Window winder RR			✓
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood this condition guide:

NAME _____

SIGNATURE _____